

TS 400 PS - BC / PL 50Hz TS 500 PS - BC / PL 60 Hz


0 9 1 0

764409003 - GB

USE AND MAINTENANCE MANUAL SPARE PARTS CATALOG

Main Characteristics of the unit:

- Maximum welding current 400A (TS400PS) - 500A (TS500PS)
- Three-phase power generation 16 kVA / single-phase 12 kVA
- Diesel engine PERKINS 404 D-22G
- Noise level at 7m 67 dBA
- Dimensions / weight: 1720x980x1100 - 780 Kg

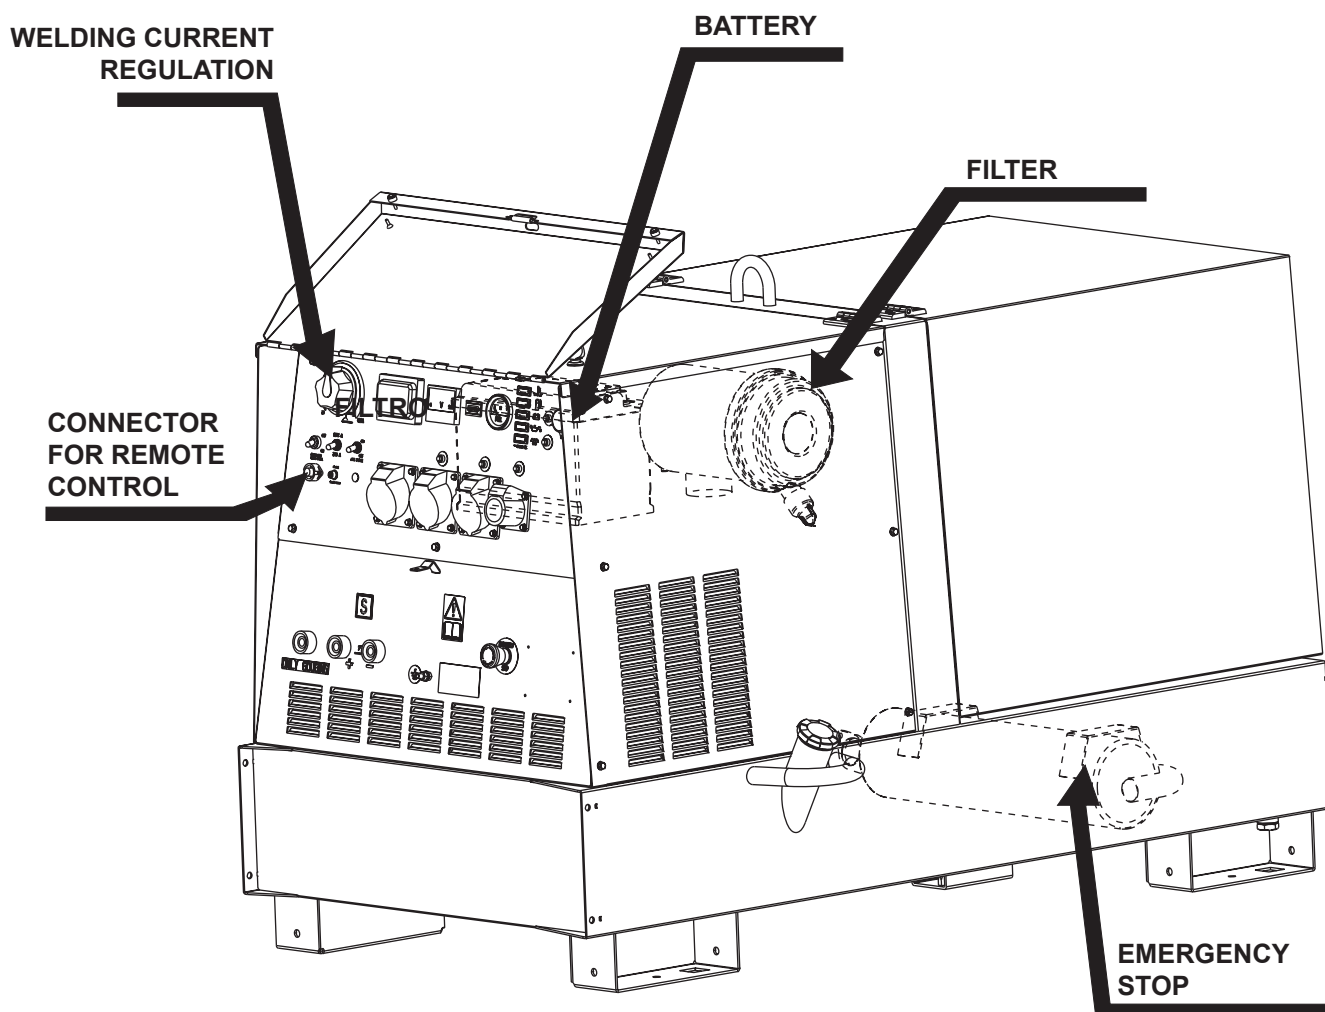

The engine driven welder has a base constructed in steel which includes the tank. A cover which is hinged to the roll bar facilitates a rapid check for daily maintenance, while a central hook on the roll bar facilitates the removal or the loading of the machine. The free maintenance battery reduces at minimum the checking of its charge condition. The engine has a low oil and a high temperature protection.



UNI EN ISO 9001 : 2008

ISO 9001:2008 - Cert. 0192

MOSA has certified its quality system according to UNI EN ISO 9001:2008 to ensure a constant, highquality of its products. This certification covers the design, production and servicing of engine driven welders and generating sets.

The certifying institute, ICIM, which is a member of the International Certification Network IQNet, awarded the official approval to MOSA after an examination of its operations at the head office and plant in Cusago (MI), Italy.

This certification is not a point of arrival but a pledge on the part of the entire company to maintain a level of quality of both its products and services which will continue to satisfy the needs of its clients, as well as to improve the transparency and the communications regarding all the company's activities in accordance with the official procedures and in harmony with the MOSA Manual of Quality.

The advantages for MOSA clients are:

- Constant quality of products and services at the high level which the client expects;
- Continuous efforts to improve the products and their performance at competitive conditions;
- Competent support in the solution of problems;
- Information and training in the correct application and use of the products to assure the security of the operator and protect the environment;
- Regular inspections by ICIM to confirm that the requirements of the company's quality system and ISO 9001 are being respected.

All these advantages are guaranteed by the CERTIFICATE OF QUALITY SYSTEM No. 0192 issued by ICIM S.p.A. - Milano (Italy) - www.icim.it

M 01	QUALITY SYSTEM
M 1.01	COPYRIGHT
M 1.1	NOTES
M 1.4	CE MARK
M 1.5	TECHNICAL DATA
M 1.6	TECHNICAL DATA
M 2	SYMBOLS
M 2.1	SYMBOLS
M 2.5	INSTALLATION AND ADVICE BEFORE USE
M 2.6	INSTALLATION AND ADVICE
M 2.7	INSTALLATION
M 3	UNPACKING
M 4	TRANSPORT AND DISPLACEMENTS
M 6.3	ASSEMBLY CTL22
M 20....	SET-UP FOR OPERATION
M 21	STARTING AND STOPPING THE ENGINE
M 31	CONTROLS
M 32	USE AS A WELDER
M 34	USE AS WELDER
M 37...	USE AS A GENERATOR
M 40...	TROUBLE SHOOTING
M 43	MAINTENANCE
M 44.1	PERIODICAL MAINTENANCE
M 45	STORAGE
M 46	CUST OFF
M 53	DIMENSIONS
M 55	RECOMMENDED ELECTRODES
M 60	ELECTRICAL SYSTEM LEGEND
M 61-.....	ELECTRICAL SYSTEM
R 1	SPARE PARTS LIST
EG ...	SPARE PARTS



ATTENTION

This use and maintenance manual is an important part of the machines in question.

The assistance and maintenance personnel must keep said manual at disposal, as well as that for the engine and alternator (if the machine is synchronous) and all other documentation about the machine.

We advise you to pay attention to the pages concerning the security (see page M1.1).



© All rights are reserved to said Company.

It is a property logo of MOSA division of B.C.S. S.p.A. All other possible logos contained in the documentation are registered by the respective owners.

■ The reproduction and total or partial use, in any form and/or with any means, of the documentation is allowed to nobody without a written permission by MOSA division of B.C.S. S.p.A.

To this aim is reminded the protection of the author's right and the rights connected to the creation and design for communication, as provided by the laws in force in the matter.

In no case MOSA division of B.C.S. S.p.A. will be held responsible for any damage, direct or indirect, in relation with the use of the given information.

MOSA division of B.C.S. S.p.A. does not take any responsibility about the shown information on firms or individuals, but keeps the right to refuse services or information publication which it judges discutible, unright or illegal.

INFORMATION

Dear Customer,
We wish to thank you for having bought from MOSA a high quality set.

Our sections for Technical Service and Spare Parts will work at best to help you if it were necessary.

To this purpose we advise you, for all control and overhaul operations, to turn to the nearest authorized Service Centre, where you will obtain a prompt and specialized intervention.

☞ In case you do not profit on these Services and some parts are replaced, please ask and be sure that are used exclusively original MOSA parts; this to guarantee that the performances and the initial safety prescribed by the norms in force are re-established.

☞ **The use of non original spare parts will cancel immediately any guarantee and Technical Service obligation from MOSA.**

NOTES ABOUT THE MANUAL

Before actioning the machine please read this manual attentively. Follow the instructions contained in it, in this way you will avoid inconveniences due to negligence, mistakes or incorrect maintenance. The manual is for qualified personnel, who knows the rules: about safety and health, installation and use of sets movable as well as fixed.

You must remember that, in case you have difficulties for use or installation or others, our Technical Service is always at your disposal for explanations or interventions.

The manual for Use Maintenance and Spare Parts is an integrant part of the product. It must be kept with care during all the life of the product.

In case the machine and/or the set should be yielded to another user, this manual must also given to him.

Do not damage it, do not take parts away, do not tear pages and keep it in places protected from dampness and heat.

You must take into account that some figures contained in it want only to identify the described parts and therefore might not correspond to the machine in your possession.

INFORMATION OF GENERAL TYPE

In the envelope given together with the machine and/or set you will find: the manual for Use Maintenance and Spare Parts, the manual for use of the engine and the tools (if included in the equipment), the guarantee (in the countries where it is prescribed by law).

Our products have been designed for the use of generation for welding, electric and hydraulic system; ANY OTHER DIFFERENT USE NOT INCLUDED IN THE ONE INDICATED, relieves MOSA from the risks which could happen or, anyway, from that which was agreed when selling the machine; MOSA excludes any responsibility for damages to the machine, to the things or to persons in this case.

Our products are made in conformity with the safety norms in force, for which it is advisable to use all these devices or information so that the use does not bring damage to persons or things.

While working it is advisable to keep to the personal safety norms in force in the countries to which the product is destined (clothing, work tools, etc.).

Do not modify for any motive parts of the machine (fastenings, holes, electric or mechanical devices, others..) if not duly authorized in writing by MOSA: the responsibility coming from any potential intervention will fall on the executioner as in fact he becomes maker of the machine.


☞ **Notice:** *this manual does not engage MOSA, who keeps the faculty, apart the essential characteristics of the model here described and illustrated, to bring betterments and modifications to parts and accessories, without putting this manual uptodate immediately.*




Any of our product is labelled with CE marking attesting its conformity to appliable directives and also the fulfillment of safety requirements of the product itself; the list of these directives is part of the declaration of conformity included in any machine standard equipment.
 Here below the adopted symbol:



CE marking is clearly readable and unerasable and it can be either part of the data-plate (A) or placed as a sticker near the data-plate (B)

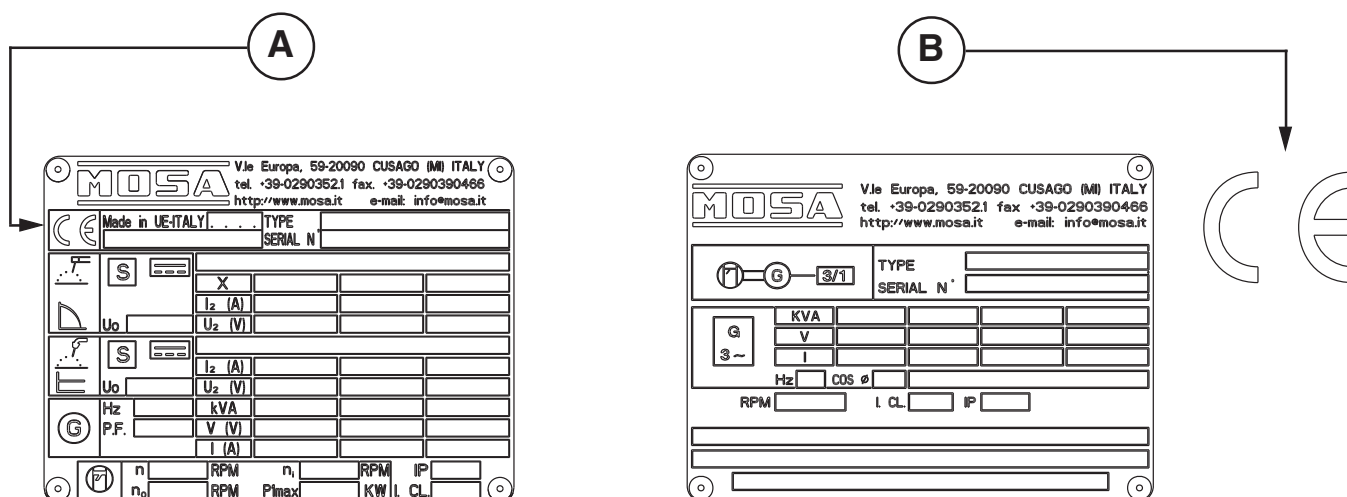

Furthermore, on each model it is shown the noise level value; the symbol used is the following:

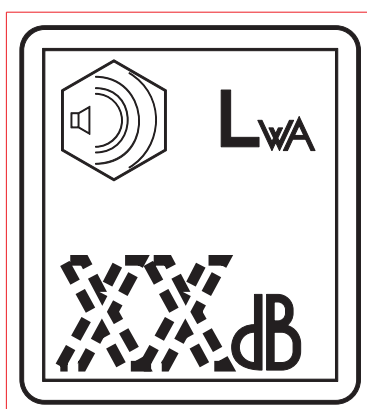


The indication is shown in a clear, readable and indeleble way on a sticker.

The TS 400/500 engine driven welder is a unit which ensures the function as:

- a) a current source for arc welding
- b) a current source for the auxiliary power generation

It is meant for industrial and professional use, powered by an endothermic engine; it is composed of various main parts such as: engine, alternator, electric and electronic controls, the fairing or a protective structure.

The assembling is made on a steel structure, on which are provided elastic support which must damp the vibrations and also eliminate sounds which would produce noise.

Technical data	TS 400 PS	TS 500 PS
A.C. GENERATOR		
Three-phase generation	16 kVA / 400 V / 23.1 A	
Single-phase generation	12 kVA / 230 V / 52.1 A	
Single-phase generation	6 kVA / 110 V / 54.4	
Single-phase generation	5 kVA / 48 V / 104 A	-
Frequency	50 Hz	60 Hz
ALTERNATOR		
	self-excited, self-regulated, brushless	
Type	three-phase, asynchronous	
Insulating class	H	
ENGINE		
Mark / Model	PERKINS / 404 D-22G	
Type / Cooling system	Diesel 4-stroke / Liquid	
Cylinders / Displacement	4 / 2216 cm ³	
Net output	20.3 kW (27.6 HP)	22.6 kW (30.7 HP)
Speed	1500 rpm	1800 rpm
Fuel consumption (welder 60%)	3.8 l/h	4.2 l/h
Cooling system capacity	7 l	
Engine oil capacity	8.5 l	
Starter	Electric	
GENERAL SPECIFICATIONS		
Battery	12V - 100Ah	
Tank capacity	60 l	
Running time (welder 60%)	16 h	
Protection	IP 23	
Dimensions / max. Lxwxh (mm) *	1720x980x1110	
Weight	780 Kg@	
Measured acoustic power LwA (pressure LpA)	91 dB(A) (66 dB(A) @ 7m)	
Guaranteed acoustic power LwA (pressure LpA)	92 dB(A) (67 dB(A) @ 7m)	
Acoustic power LwA (pressure LpA)	94 dB(A) (69 dB(A) @ 7m)	
* Dimensions and weight are inclusive of all parts without wheels and towbar		
		

* Dimensions and weight are inclusive of all parts without wheels and towbar



POWER

Declared power according to ISO 3046-1 (temperature 25°C, 30% relative humidity, altitude 100 m above sea level).

It's admitted overload of 10% each hour every 12 h.

In an **approximative** way one reduces: of 1% every 100 m altitude and of 2.5% for every 5°C above 25°C.

ACOUSTIC POWER LEVEL

ATTENTION: The concrete risk due to the machine depends on the conditions in which it is used. Therefore, it is up to the end-user and under his direct responsibility to make a correct evaluation of the same risk and to adopt specific precautions (for instance, adopting a I.P.D. - Individual Protection Device)

Acoustic Noise Level (L_{WA}) - Measure Unit dB(A): it stands for acoustic noise released in a certain delay of time. This is not submitted to the distance of measurement.

Acoustic Pressure (L_p) - Measure Unit dB(A): it measures the pressure originated by sound waves emission. Its value changes in proportion to the distance of measurement.

The here below table shows examples of acoustic pressure (L_p) at different distances from a machine with Acoustic Noise Level (L_{WA}) of 95 dB(A)

L_p a 1 meter = 95 dB(A) - 8 dB(A) = 87 dB(A)

L_p a 4 meters = 95 dB(A) - 20 dB(A) = 75 dB(A)

L_p a 7 meters = 95 dB(A) - 25 dB(A) = 70 dB(A)

L_p a 10 meters = 95 dB(A) - 28 dB(A) = 67 dB(A)

PLEASE NOTE: the symbol when with acoustic noise values, indicates that the device respects noise emission limits according to 2000/14/CE directive.

D.C. WELDING

Welding current electronic
regulation (on two scales)

Service

Striking voltage

TS 400 PS - 50 Hz

20 - 200 / 20 - 400 A

400 A - 60%, 350 A - 100%


70 V

TS 500 PS - 60 Hz

20 - 200 / 20 - 400 A

500 A - 35%, 450 A - 60%, 400 A - 100%

70 V

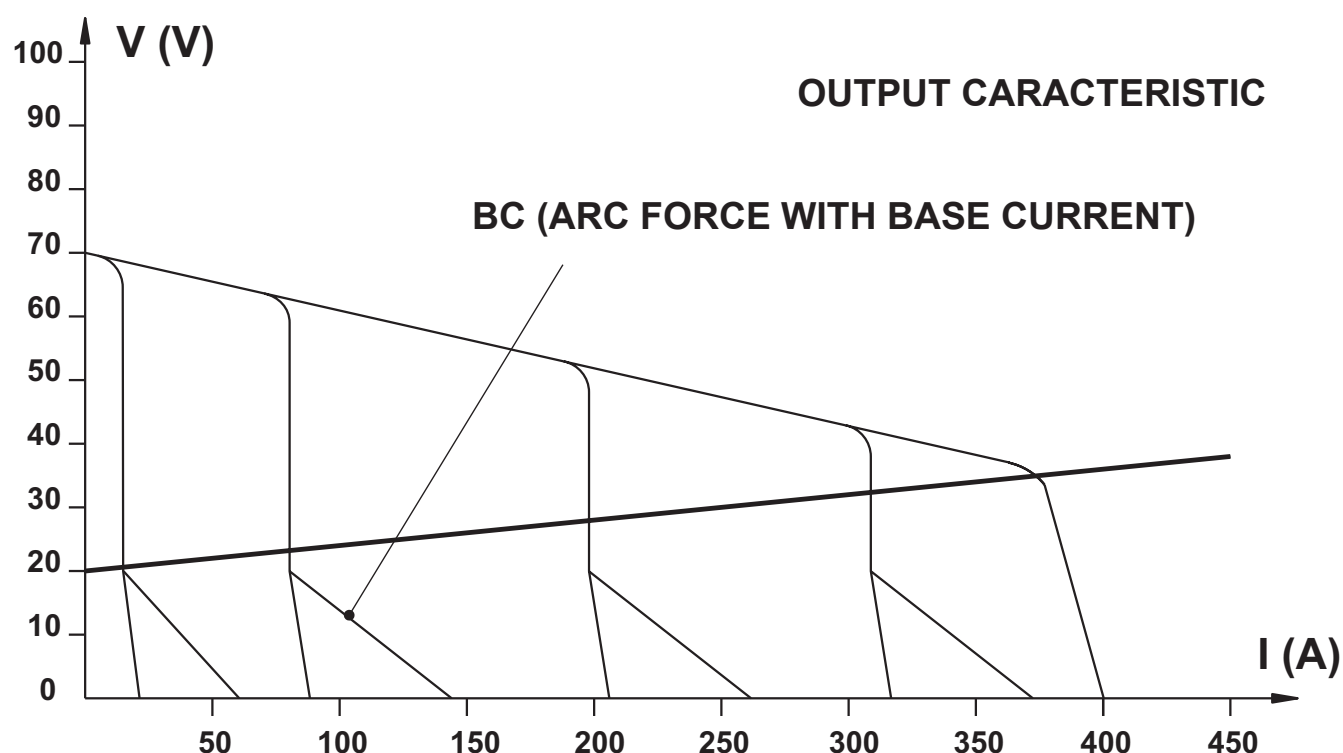

SIMULTANEOUS UTILIZATION FACTORS

In case Welding and Generation can be used simultaneously, however, the engine cannot be overloaded. The table below gives the maximum limits to be respected:

WELDING CURRENT	>250 A	200 A	150 A	100 A	0
AUXILIARY POWER	0	4 kVA	7.5 kVA	10 kVA	16 kVA

SYMBOLS IN THIS MANUAL

- The symbols used in this manual are designed to call your attention to important aspects of the operation of the machine as well as potential hazards and dangers for persons and things.

IMPORTANT ADVICE

- Advice to the User about the safety:

N.B.: The information contained in the manual can be changed without notice. Potential damages caused in relation to the use of these instructions will not be considered because these are only indicative. Remember that the non observance of the indications reported by us might cause damage to persons or things. It is understood, that local dispositions and/or laws must be respected.

WARNING



Situations of danger - no harm to persons or things

Do not use without protective devices provided

Removing or disabling protective devices on the machine is prohibited.

Do not use the machine if it is not in good technical condition

The machine must be in good working order before being used. Defects, especially those which regard the safety of the machine, must be repaired before using the machine.

SAFETY PRECAUTIONS



DANGEROUS

This heading warns of an immediate danger for persons as well for things. Not following the advice can result in serious injury or death.



WARNING

This heading warns of situations which could result in injury for persons or damage to things.



CAUTION

To this advice can appear a danger for persons as well as for things, for which can appear situations bringing material damage to things.



IMPORTANT



NOTE



ATTENTION

These headings refer to information which will assist you in the correct use of the machine and/or accessories.

SYMBOLS



STOP - Read absolutely and be duly attentive



Read and pay due attention



GENERAL ADVICE - If the advice is not respected damage can happen to persons or things.



HIGH VOLTAGE - Attention High Voltage. There can be parts in voltage, dangerous to touch. The non observance of the advice implies life danger.



FIRE - Danger of flame or fire. If the advice is not respected fires can happen.



HEAT - Hot surfaces. If the advice is not respected burns or damage to things can be caused.



EXPLOSION - Explosive material or danger of explosion. in general. If the advice is not respected there can be explosions.



WATER - Danger of shortcircuit. If the advice is not respected fires or damage to persons can be caused.



SMOKING - The cigarette can cause fire or explosion. If the advice is not respected fires or explosions can be caused.



ACIDS - Danger of corrosion. If the advice is not respected the acids can cause corrosions with damage to persons or things.



WRENCH - Use of the tools. If the advice is not respected damage can be caused to things and even to persons.



PRESSION - Danger of burns caused by the expulsion of hot liquids under pressure.



ACCES FORBIDDEN to non authorizad people.

PROHIBITIONS No harm for persons

Use only with safety clothing -



It is compulsory to use the personal protection means given in equipment.

Use only with safety clothing -



It is compulsory to use the personal protection means given in equipment.

Use only with safety protections -



It is a must to use protection means suitable for the different welding works.

Use with only safety material -



It is prohibited to use water to quench fires on the electric machines.

Use only with non inserted voltage -



It is prohibited to make interventions before having disinserted the voltage.

No smoking -



It is prohibited to smoke while filling the tank with fuel.

No welding -



It is forbidden to weld in rooms containing explosive gases.

ADVICE No harm for persons and things

Use only with safety tools, adapted to the specific use -

It is advisable to use tools adapted to the various maintenance works.

Use only with safety protections, specifically suitable



It is advisable to use protections suitable for the different welding works.

Use only with safety protections -



It is advisable to use protections suitable for the different daily checking works.

Use only with safety protections -



It is advisable to use all protections while shifting the machine.

Use only with safety protections -



It is advisable to use protections suitable for the different daily checking works.and/or of maintenance.



The installation and the general advice concerning the operations, are finalized to the correct use of the machine, in the place where it is used as generator group and/or welder.

ENGINE	Stop engine when fueling	CHECKING BOARD	Do not touch electric devices if you are barefoot or with wet clothes.
	Do not smoke, avoid flames, sparks or electric tools when fueling.		
	Unscrew the cap slowly to let out the fuel vapours.		Always keep off leaning surfaces during work operations.
	Slowly unscrew the cooling liquid tap if the liquid must be topped up.		
	The vapor and the heated cooling liquid under pressure can burn face, eyes, skin.		Static electricity can damage the parts on the circuit.
	Do not fill tank completely.		
	Wipe up spilled fuel before starting engine.		An electric shock can kill
	Shut off fuel of tank when moving machine (where it is assembled).		
	Avoid spilling fuel on hot engine.		
	Sparks may cause the explosion of battery vapours		



FIRST AID. In case the operator should be sprayed by accident, from corrosive liquids a/o hot toxic gas or whatever event which may cause serious injuries or death, predispose the first aid in accordance with the ruling labour accident standards or of local instructions.

Skin contact	Wash with water and soap
Eyes contact	Irrigate with plenty of water, if the irritation persists contact a specialist
Ingestion	Do not induce vomit as to avoid the intake of vomit into the lungs, send for a doctor
Suction of liquids from lungs	If you suppose that vomit has entered the lungs (as in case of spontaneous vomit) take the subject to the hospital with the utmost urgency
Inhalation	In case of exposure to high concentration of vapours take immediately to a non polluted zone the person involved



FIRE PREVENTION. In case the working zone, for whatsoever cause goes on fire with flames liable to cause severe wounds or death, follow the first aid as described by the ruling norms or local ones.

EXTINCTION MEANS	
Appropriated	Carbonate anhydride (or carbon dioxide) powder, foam, nebulized water
Not to be used	Avoid the use of water jets
Other indications	Cover eventual shedding not on fire with foam or sand, use water jets to cool off the surfaces close to the fire
Particular protection	Wear an autorespiratory mask when heavy smoke is present
Useful warnings	Avoid, by appropriate means to have oil sprays over metallic hot surfaces or over electric contacts (switches, plugs, etc.). In case of oil sprinkling from pressure circuits, keep in mind that the inflammability point is very low.

WARNING					CAUTION		DANGER

	WARNING	THE MACHINE <u>MUST NOT BE USED</u> IN AREAS WITH EXPLOSIVE ATMOSPHERE
--	----------------	---



INSTALLATION AND ADVICE BEFORE USE

The operator of the welder is responsible for the security of the people who work with the welder and for those in the vicinity.

The security measures must satisfy the rules and regulations for engine driven welders.

The information given below is in addition to the local security norms.

Estimate possible electromagnetic problems in the work area taking into account the following indications.

1. Telephonic wirings and/or of communication, check wirings and so on, in the immediate vicinity.
2. Radio and television receptors and transmitters.
3. Computer and other checking devices.
4. Critical devices for safety and/or for industrial checks.
5. People who, for instance, use pace-maker, hearing-aid for deaf or something and else.
6. Devices used for rating and measuring.
7. The immunity of other devices in the operation area of the welder. Make sure that other used devices are compatible. If it is the case, provide other additional measures of protection.
8. The daily duration of the welding time.



Make sure that the area is safe before starting any welding operation.

- Do not touch any bare wires, leads or contacts as they may be live and there is danger of electric shock which can cause death or serious burns. The electrode and welding cables, etc. are live when the unit is operating.
- Do not touch any electrical parts or the electrode while standing in water or with wet hands, feet or clothes.
- Insulate yourself from the work surface while welding. Use carpets or other insulating materials to avoid physical contact with the work surface and the floor.
- Always wear dry, insulating gloves, without holes, and body protection.
- Do not wind cables around the body.
- Use ear protections if the noise level is high.
- Keep flammable material away from the welding area.
- Do not weld on containers which contain flammable material.
- Do not weld near refuelling areas.
- Do not weld on easily flammable surfaces.
- Do not use the welder to defrost (thaw) pipes.
- Remove the electrode from the electrode holder, when not welding.
- Avoid inhaling fumes by providing a ventilation system or, if not possible, use an approved air breather.
- Do not work in closed areas where there is no fresh air flow.
- Protect face and eyes (protective mask with suitable dark lens and side screens), ears and body (non-flammable protective clothes).





INSTALLATION AND ADVICE BEFORE USE

GASOLINE ENGINES

- Use in open space, air swept or vent exhaust gases, which contain the deathly carbone oxyde, far from the work area.


DIESEL ENGINES

- Use in open space, air swept or vent exhaust gases far from the work area.

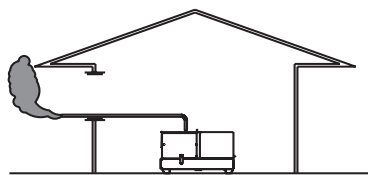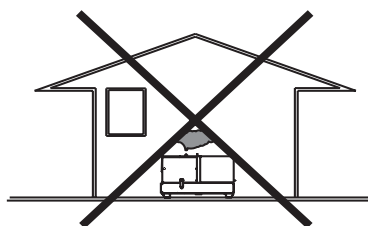


POSITION


Place the machine on a level surface at a distance of at least 1,5 m from buildings or other plants.

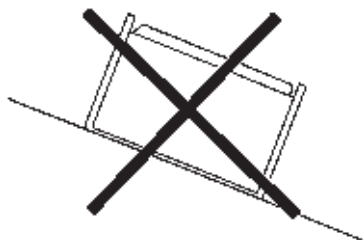

Maximum leaning of the machine (in case of dislevel)

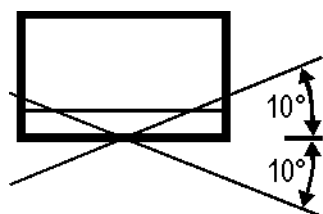


$\alpha = 20^\circ \text{ max}$

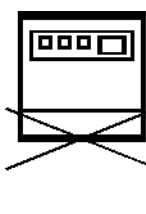

$\beta = 20^\circ \text{ max}$

Check that the air gets changed completely and the hot air sent out does not come back inside the set so as to cause a dangerous increase of the temperature.

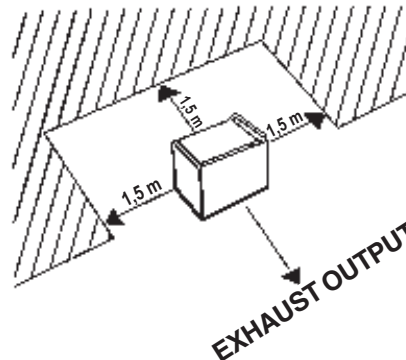

- ☞ Make sure that the machine does not move during the work: **block** it possibly with tools and/or devices made to this purpose.

MOVES OF THE MACHINE

- ☞ At any move check that the engine is **off**, that there are no connections with cables which impede the moves.

PLACE OF THE MACHINE





ATTENTION



For a safer use from the operator **DO NOT** fit the machine in locations with high risk of flood.

Please do not use the machine in weather conditions which are beyond IP protection shown both in the data plate and on page named "technical data" in this same manual.

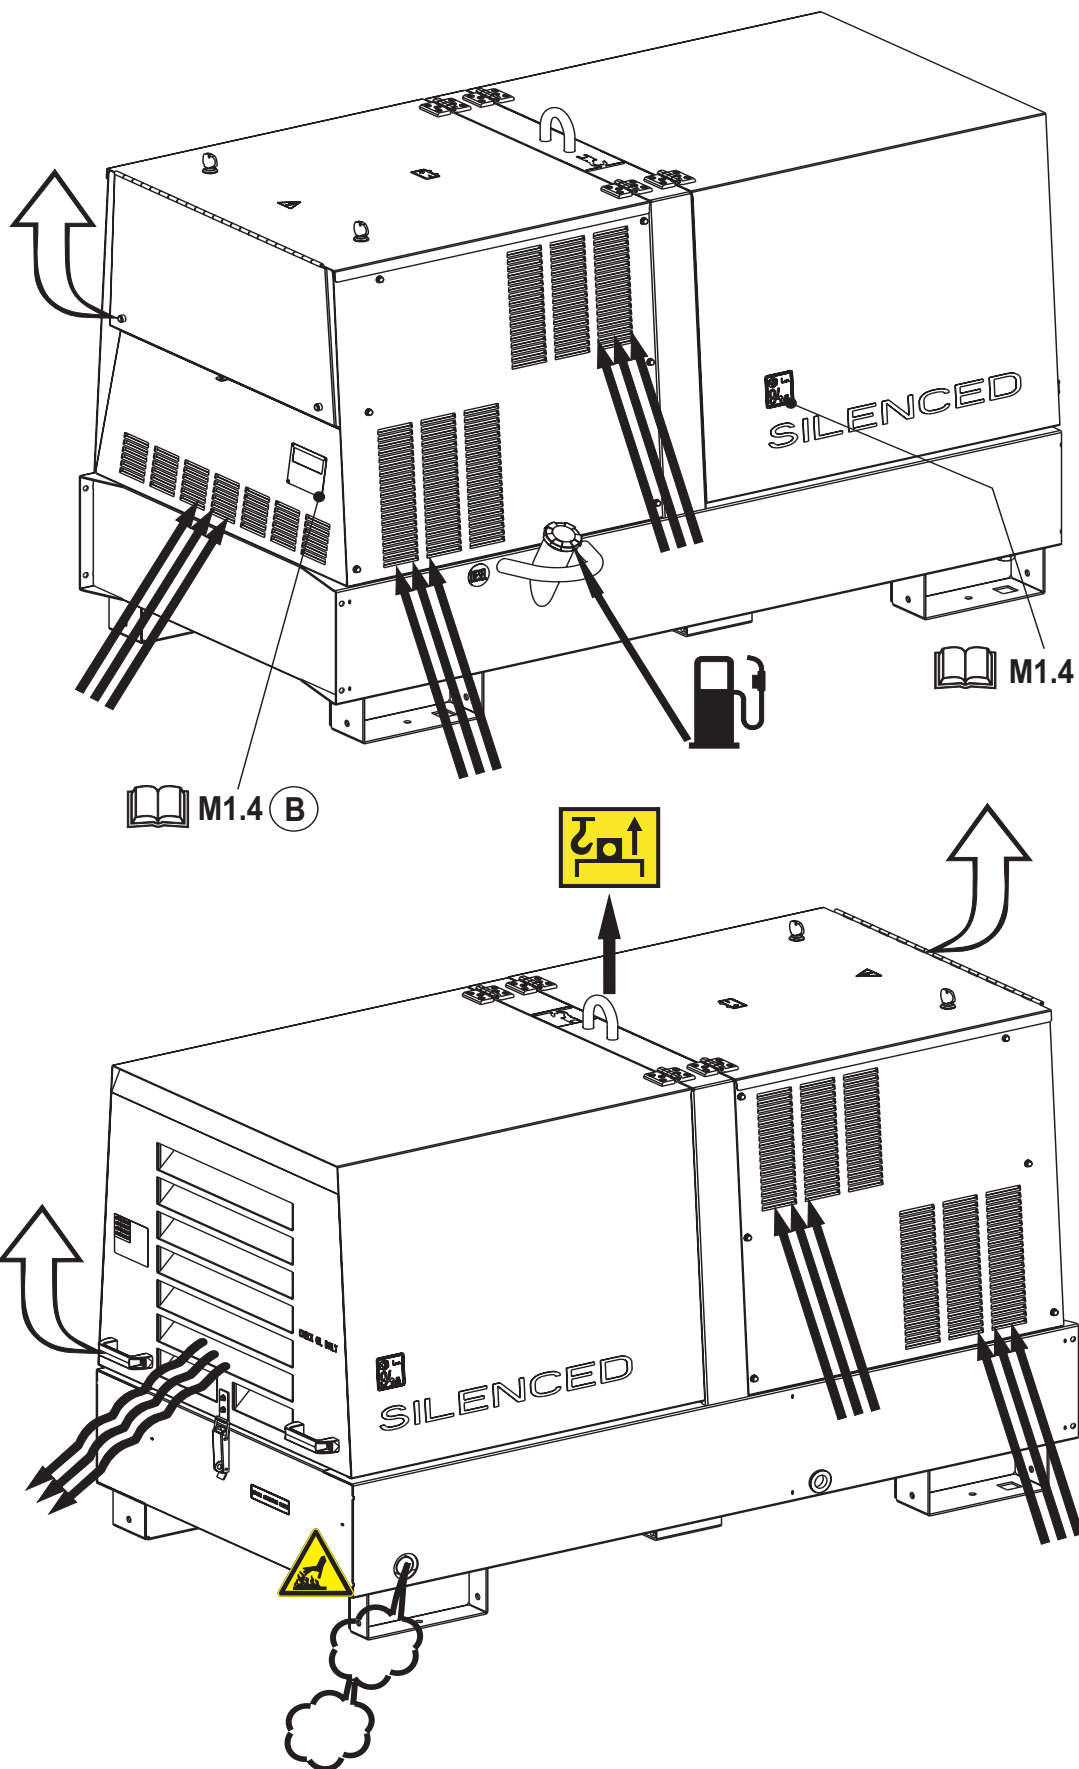

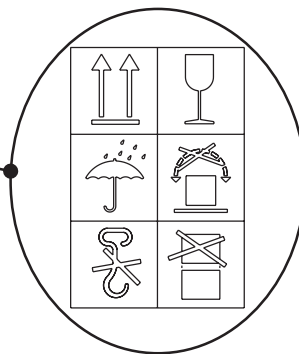



NOTE

Transportation must always take place with the engine off, electrical cables and starting battery disconnected and fuel tank empty.



Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with it's packaging, and conform to local rules and regulations.

Only authorized persons involved in the transport of the machine should be in the area of movement.

DO NOT LOAD OTHER PARTS WHICH CAN MODIFY WEIGHT AND BARICENTER POSITION.

IT IS STRICTLY FORBIDDEN TO DRAG THE MACHINE MANUALLY OR TOW IT BY ANY VEHICLE (model with no CTL accessory).

If you did not keep to the instructions, you could damage the structure of the machine.

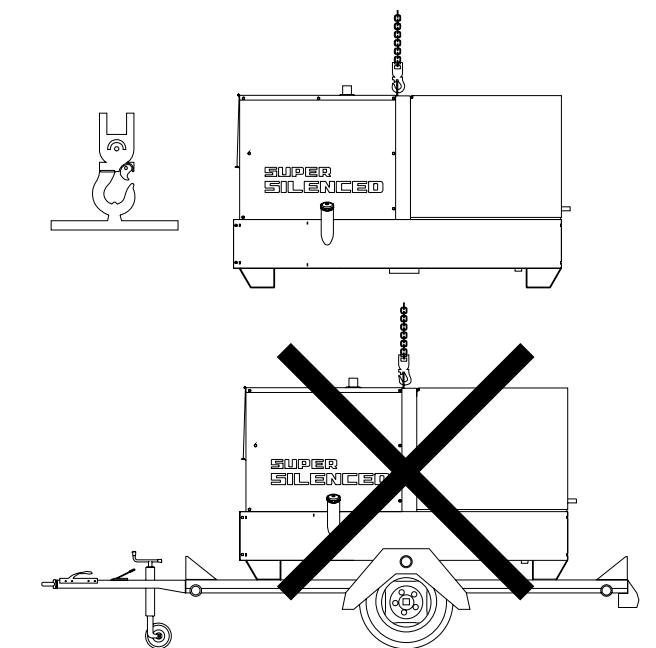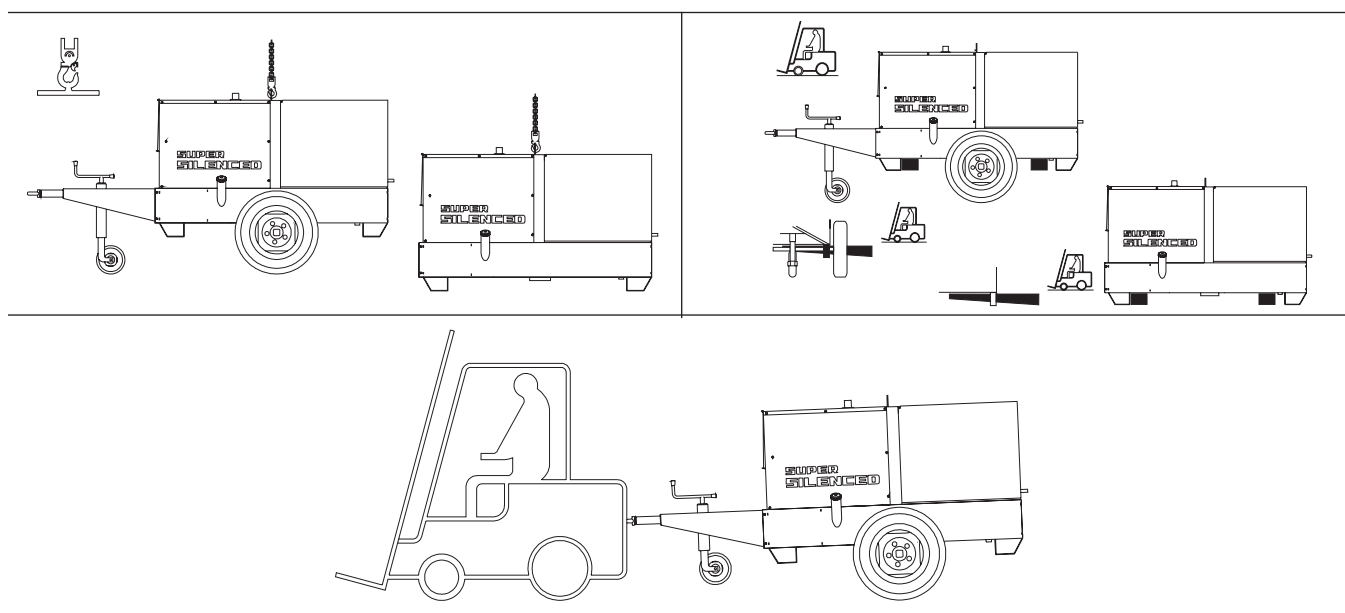

LIFT ONLY THE MACHINE

DO NOT LIFT THE MACHINE AND TRAILER



DANGER: LIFTING EYE IS NOT DESIGNED TO SUPPORT
ADDED WEIGHT OF ROAD TOW TRAILER





ATTENZIONE


The CTL accessory cannot be removed from the machine and used separately (actioned manually or following vehicles) for the transport of loads or anyway for used different from the machine movements.

TRAILERS

The machines provided for assembling the accessory (slow towing trolley) can be towed up to a **maximum** speed of **40 Kms/hour** on asphalted surfaces.



Towing on public roads or turnpikes of any type **IS EXCLUDED**, because **not** in possession of the requirements by national and foreign traffic norms.

Nota: Lift the machine and assemble the parts as shown in the drawing

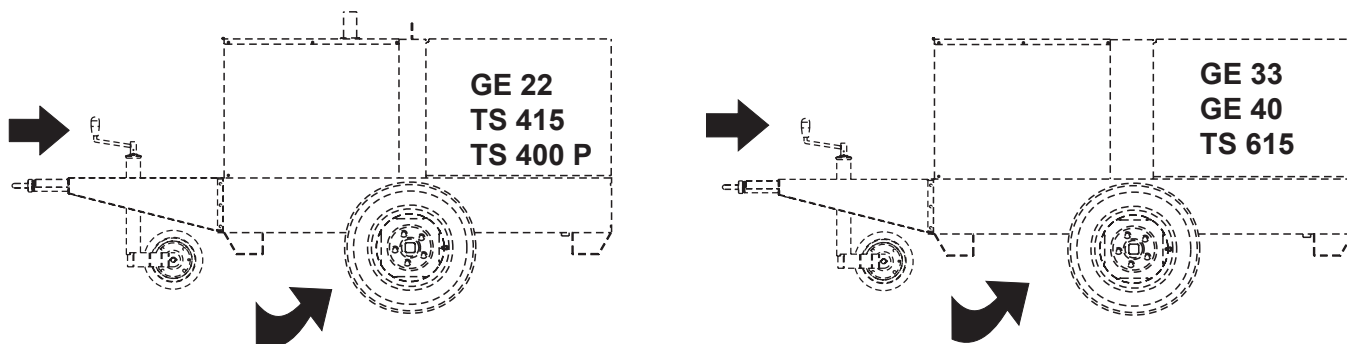

To assemble the generating set on the trolley CTL 22 please keep to following instructions:

- 1) - Lift the generating set (by means of a suitable hook).
- 2) - Slightly fix the jaw (3) of the parking foot to the bar with the screws (4V), the nuts and the washers and tighten all parts
- 3) - Open the jaw so as to let the foot sprag (4S) go through
- 4) - Introduce into the jaw (3) the upper part (4S) of the foot and block momentarily with the lever (4L) the whole foot.
- 6) - Assemble on the machine the towbar (5) complete of foot with the screws, nuts and washers.
- 7) - Assemble the axle (7) to the base of the machine with the screws and relative washers (two per part) so that their supports coincide.
- 8) - Insert the wheel (9) on the axle then screw the self blocking nuts (8).
- 9) - Pump the tyre (9) fixing the pressure to four atms.
- 10) - Lower the machine to the ground and place the parking foot definitively (regulating at the suitable height).

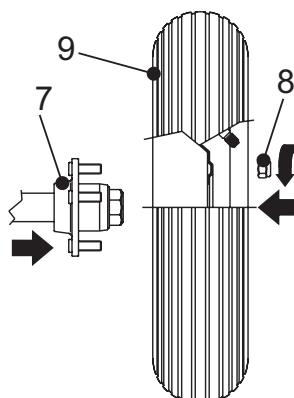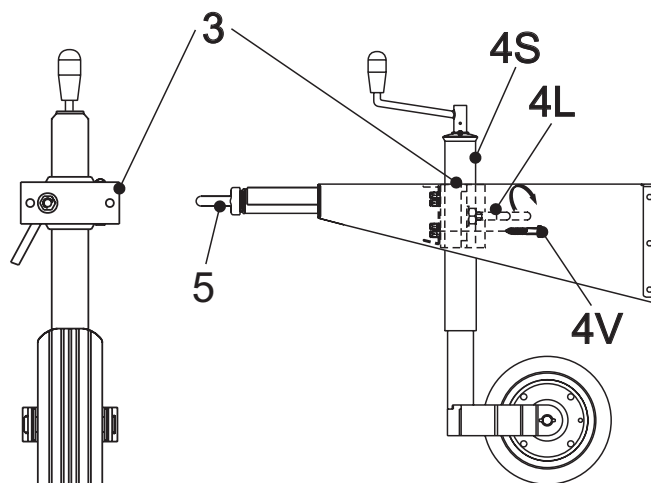

ATTENTION

Do not substitute the original tires with other types.



BATTERY WITHOUT MAINTENANCE



Connect the cable + (positive) to the pole + (positive) of the battery (after having taken away the protection), by properly tightening the clamp.

Check the state of the battery from the colour of the warning light which is in the upper part.

- Green colour: battery OK
- Black colour: battery to be recharged
- White colour: battery to be replaced

DO NOT OPEN THE BATTERY.



LUBRICANT

RECOMMENDED OIL

MOSA recommends selecting **AGIP** engine oil. Refer to the label on the motor for the recommended products.

Please refer to the motor operating manual for the recommended viscosity.

PRODOTTI RACCOMANDATI RECOMMENDED PRODUCTS	
AGIP SIGMA TURBO PLUS 15W/40 API CG4 - ACEA E3	OLIO MOTORE DIESEL DIESEL ENGINE OIL <input type="checkbox"/>
AGIP SUPERMOTOROIL 20W/50 API CC-SF	OLIO MOTORE BENZINA GASOLINE ENGINE OIL <input type="checkbox"/>
AGIP ANTIFREEZE EXTRA INIBITE ETHYLENE GLYCOL (50% + 50% + H ₂ O)	CIRCUITO DI RAFFREDDAMENTO COOLING CIRCUIT (CUNA NC 956-16 ED 97) <input type="checkbox"/>



AIR FILTER

Check that the dry air filter is correctly installed and that there are no leaks around the filter which could lead to infiltrations of non-filtered air to the inside of the motor.



FUEL



ATTENTION



Do not smoke or use open flames during refuelling operations, in order to avoid explosions or fire hazards.



Fuel fumes are highly toxic; carry out operations outdoors only, or in a well-ventilated environment.

Avoid accidentally spilling fuel. Clean any eventual leaks before starting up motor.

Refill the tank with good quality diesel fuel, such as automobile type diesel fuel, for example.

For further details on the type of diesel fuel to use, see the motor operating manual supplied.

Do not fill the tank completely; leave a space of approx. 10 mm between the fuel level and the wall of the tank to allow for expansion.

In rigid environmental temperature conditions, use special winterized diesel fuels or specific additives in order to avoid the formation of paraffin.

REFUELLING AND CONTROL:

Carry out refuelling and controls with motor at level position.

1. Remove the oil-fill tap (24)
2. Pour oil and replace the tap
3. Check the oil level using the dipstick (23); the oil level must be comprised between the minimum and maximum indicators.



ATTENTION

It is dangerous to fill the motor with too much oil, as its combustion can provoke a sudden increase in rotation speed.





COOLING LIQUID



ATTENTION



Do not remove the radiator tap with the motor in operation or still hot, as the liquid coolant may spurt out and cause serious burns. Remove the tap very carefully.

Remove the tap and pour the liquid coolant into the radiator; the quantity and composition of the liquid coolant are indicated in the motor operating manual. Replace the tap, ensuring it is perfectly closed. After refilling operations, allow the motor to run for a brief time and check the level, as it may have diminished due to air bubbles present in the cooling circuit; restore the level with water. To replace the liquid coolant, follow the operations described in the motor operating manual.



GROUNDING CONNECTION

The grounding connection to an earthed installation **is obligatory** for all models equipped with a differential switch (circuit breaker). In these groups the generator star point is generally connected to the machine's earthing; by employing the TN or TT distribution system, the differential switch guarantees protection against indirect contacts.

In the case of powering complex installations requiring or employing additional electrical protection devices, the coordination between the protection devices must be verified.

For the grounding connection, use the terminal (12); comply to local and/or current regulations in force for electrical installations and safety.



Check daily



 

NOTE

Do not alter the primary conditions of regulation and do not touch the sealed parts.


START-UP

1. By start-up of the generator the welding circuit is immediately operative, i.e. under voltage. Make sure that there are no unwished electrical contacts between the components of the outside welding circuit (electrode, electrode holder gun, workpiece, etc...).

2. Check that at the start-up the a.c. auxiliary generation sockets do not feed any load. Open the GFI (D) of the generator or disconnect the plugs of the loads from the sockets.

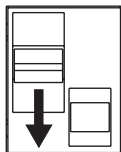

 3. turn the start key (Q1) to the preheat position, identified by a picture of a spark plug. Keep the key in this position for about 5 seconds, the action is shown by the preheating light on (I4). Turn the start key to the ON position and then on START.



After the start-up of the motor, release the key, which will automatically place itself in the ON position;

4. the motor starts up at its operating speed, 1500 or 1800 rpm. After start-up, allow the motor to run for a few minutes before powering on the utilities. See table;

Temperature	Time
$\leq -20^{\circ}\text{C}$	5 min.
to -20°C from -10°C	2 min.
to -10°C from -5°C	1 min.
$\geq 5^{\circ}\text{C}$	20 sec.

5. start-up at low temperatures.

The motor will normally start up without problems down to temperatures of -10°C , -15°C . In case of starting difficulty, it is possible to repeat the starting preheating for a max. time of 10


seconds. For start-up and use at lower temperatures please see the engine manual or turn to our Technical Assistance Center.

In case of unsuccessful start-up, do not insist for longer than 5 seconds. Wait 10 - 15 seconds before attempting another start-up .


STOP

For shutdown under normal conditions, proceed as follows:

1. Break the welding process in course.

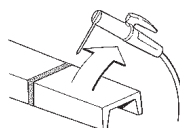


2. Break the production of a.c. auxiliary generation dividing the loads or opening the GFI (D).

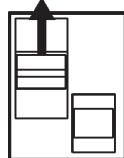

3. Let the engine run with no load for a few minutes.

 4. Turn the start key (Q1) to the OFF position.



EMERGENCY SHUTDOWN

To stop the group in a dangerous situation, press the emergency stop button (L5) (or turn the start key (Q1) to the OFF position). To reset the knob, turn it clockwise.




CAUTION

RUNNING-IN


During the first 50 hours of operation, do not use more than 60% of the maximum output power of the unit and check the oil level frequently, in any case please stick to the rules given in the engine use manual.

4A	Hydraulic oil level light	A4	Button indicating light 30 l/1' PTO HI	W5	Battery voltmeter
9	Welding socket (+)	B2	Engine control unit EP2	X1	Remote control socket
10	Welding socket (-)	B3	E.A.S. connector	Y3	Button indicating light 20 l/1' PTO HI
12	Earth terminal	B4	Exclusion indicating light PTO HI	Y5	Commutator/switch, serial/parallel
15	A.C. socket	B5	Auxiliary current push button	Z2	Thermal-magnetic circuit breaker
16	Accelerator lever	C2	Fuel level light	Z3	Selection push button 20 l/1' PTO HI
17	Feed pump	C3	E.A.S. PCB	Z5	Water temperature indicator
19	48V D.C. socket	C6	Control unit for generating sets QEA		
22	Engine air filter	D	Ground fault interrupter (30 mA)		
23	Oil level dipstick	D1	Engine control unit and economiser EP1		
24	Engine oil reservoir cap	D2	Ammeter		
24A	Hydraulic oil reservoir cap	E2	Frequency meter		
24B	Water filling cap	F	Fuse		
25	Fuel prefilter	F3	Stop switch		
26	Fuel tank cap	F5	Warning light, high temperature		
27	Muffler	F6	Arc-Force selector		
28	Stop control	G1	Fuel level transmitter		
29	Engine protection cover	H2	Voltage commutator		
30	Engine cooling/alternator fan belt	H6	Fuel electro pump		
31	Oil drain tap	H8	Engine control unit EP7		
31A	Hydraulic oil drain tap	I2	48V A.C. socket		
31B	Water drain tap	I3	Welding scale switch		
31C	Exhaust tap for tank fuel	I4	Preheating indicator		
32	Button	I5	Y/▲ switch		
33	Start button	I6	Start Local/Remote selector		
34	Booster socket 12V	I8	AUTOIDLE switch		
34A	Booster socket 24V	L	A.C. output indicator		
35	Battery charge fuse	L5	Emergency button		
36	Space for remote control	L6	Choke button		
37	Remote control	M	Hour counter		
42	Space for E.A.S.	M1	Warning level light		
42A	Space for PAC	M2	Contacteur		
47	Fuel pump	M5	Engine control unit EP5		
49	Electric start socket	M6	CC/CV switch		
54	Reset button PTO HI	N	Voltmeter		
55	Quick coupling m. PTO HI	N1	Battery charge warning light		
55A	Quick coupling f. PTO HI	N2	Thermal-magnetic circuit breaker/ Ground fault interrupter		
56	Hydraulic oil filter		Pre-heat push-button		
59	Battery charger thermal switch	N5	Connector - wire feeder		
59A	Engine thermal switch	N6	Oil pressure warning light/Oil alert		
59B	Aux current thermal switch	O1	Welding arc regulator		
59C	Supply thermal switch wire feeder- 42V	P	Starter key		
59D	Pre-heater (spark plug) thermal switch	Q1	Derivation box		
59E	Supply thermal switch oil/water heater	Q3	Battery charge sockets		
59F	Electropump thermal switch	Q4	Welding selector mode		
63	No load voltage control	Q7	Siren		
66	Choke control	R3	Welding ammeter		
67A	Auxiliary / welding current control	S	Battery		
68	Cellulosic electrodes control	S1	Engine control unit EP4		
69A	Voltmeter relay	S3	Wire feeder supply switch		
70	Warning lights	S6	Plug 230V singlephase		
71	Selecting knob	S7	Welding current regulator		
72	Load commut. push button	T	Dirty air filter warning light/indicator		
73	Starting push button	T4	Earth leakage relay		
74	Operating mode selector	T5	Analogic instrument V/Hz		
75	Power on warning light	U	Current transformer		
76	Display	U3	R.P.M. adjuster		
79	Wire connection unit	U4	Polarity inverter remote control		
86	Selector	U5	Release coil		
86A	Setting confirmation	U7	Engine control unit EP6		
87	Fuel valve	V	Welding voltage voltmeter		
88	Oil syringe	V4	Polarity inverter control		
A3	Insulation monitoring	V5	Oil pressure indicator		
		W1	Remote control switch		
		W3	Selection push button 30 l/1' PTO HI		




400T230M48M
VERSION

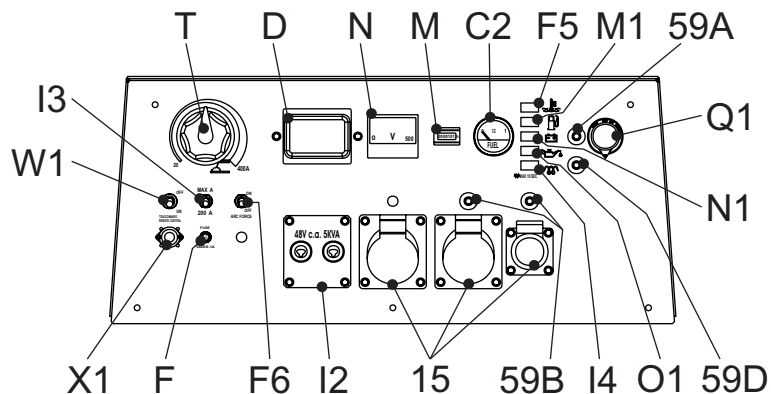



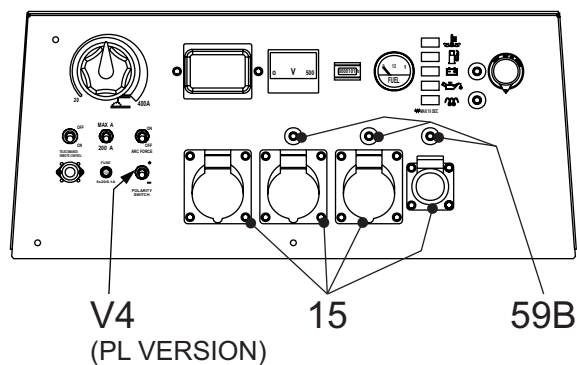




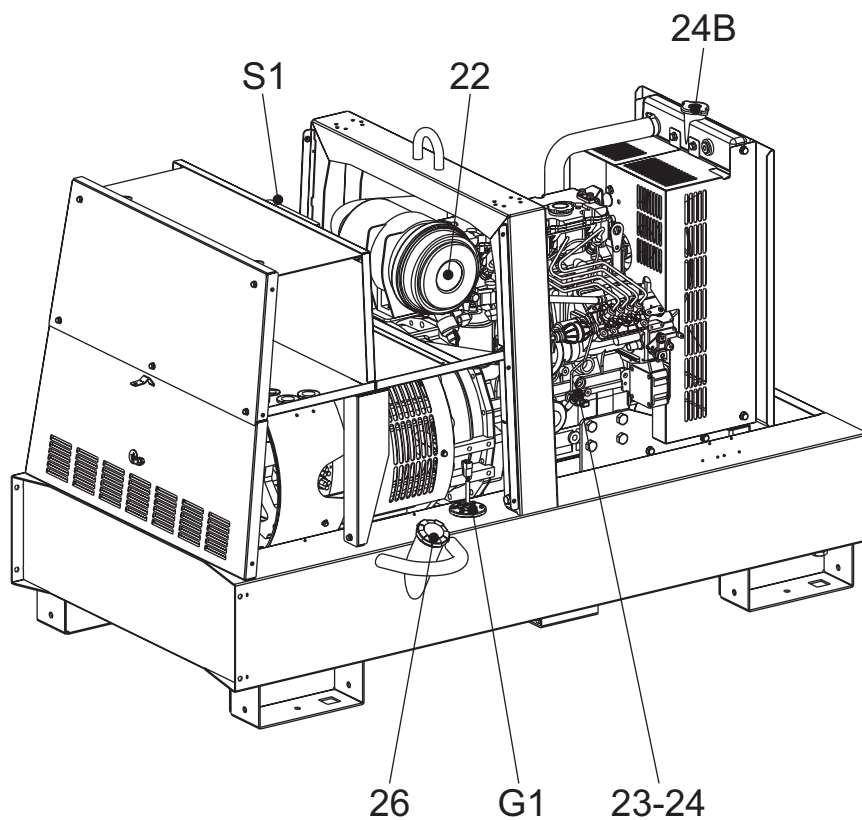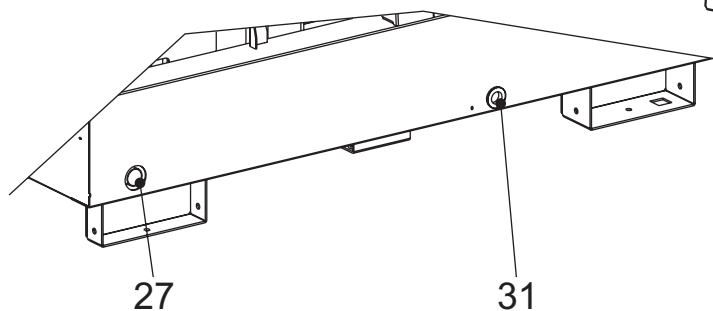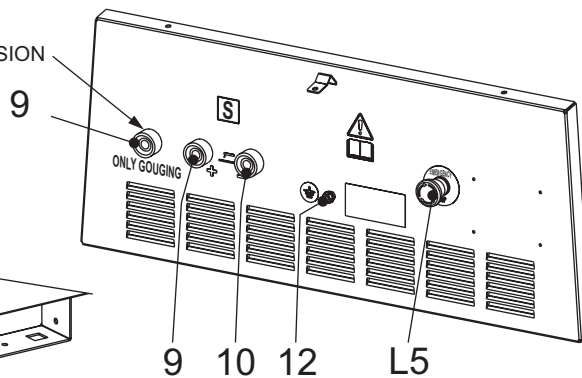







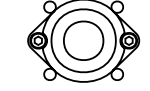



400T230M110M
VERSION



 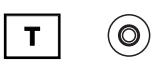




NO PL VERSION

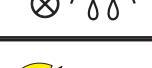

	9 c.c. welding sockets (+) 10 c.c. welding sockets (-) 9 c.c. socket only gouging. Outlet used only for cutting works.	Connection sockets for welding cables.
	T Welding current regulator - allows the regulation of the welding current.	
	I3 Switch for welding scale reduction - Placed on 200A it limits the maximum value of the welding current regulator (T) at 200A, so permitting a more accurate regulation of the welding current.	
	F6 Arc - Force selector - In ON position it inserts the BC circuit (base current).	
	V4 Polarity inverter control - Positioned on "-" it inverts the polarity at the welding sockets (PL Version).	
	W1 Remote control switch - In ON position it qualifies the remote control to regulate the welding current.	
	X1 Remote control socket (connector) - Multi-pole connector for remote control.	
	F Fuse - Protect the electronic welding card in case of short - circuited remote control (100mA/250V - 5x20 mm)	

	Motor protection - Motor control circuit with automatic shutdown for low oil pressure and high temperature.	
	Q1 Start-up key - Control unit for start-up, shutdown and preheating operations.	
	59A Motor thermic protection - Protects the battery circuit auxiliary devices: pilot lights, relays, instruments, sensors, etc. from power overloads and short circuits.	
	M Hours counter - Indicates effective operating hours for the electricity-generating group.	
	O1 Oil pressure warning light - If on during the group's operation, indicates a malfunction in the motor's oil circuit.	
	F5 High temperature warning light - For groups with water cooled motor, indicates a malfunction in the cooling circuit.	
	N1 Battery charge warning light - If on during the group's operation, indicates a malfunction in the motor's battery charge circuit.	
	M1 Low fuel warning light - If on, indicates the fuel in the tank has reached the low level point.	
	C2 Fuel level indicator - Indicates the percentage of fuel in the fuel tank.	
	I4 Preheating pilot light - If on, indicates the activation of the preheating circuit.	
	L5 Emergency stop button - Allows for the group's immediate stop in case of danger, and prevents start-up until it is released.	

	15- 12 a.c. current sockets - Load connection point to generator.	
	D Differential switch - Generally with a current of 30 mA, this is the safety device against indirect contacts.	
	59B Thermal protection for inputs c.a. - Protects individual sockets, generally the mono-phase inputs, from overloads.	
	N Line voltmeter - The presence of line voltage indicates power can be drawn from the sockets c.a.	
	12 Grounding terminal - PE terminal for the group's earthing connection to a grounding installation.	



This symbol (Norm EN 60974-1 security standards for arc welders) signifies that the welder can be used in areas with increased risk of electrical shock.




ATTENTION

The welding sockets, after the machine is started, also with no cables, are anyway under voltage.

Check at the beginning of any work the electric parameters and/or the control placed on the front.

Make sure that the ground connection (12) is efficient (keep to installation local rules and/or to national laws), in order to integrate or ensure the working of various electric protection devices referring to the several distribution system TT/TN/IT, operation unnecessary for machine with isometer.

Fully insert the welding cable plugs into the corresponding sockets ("only gauging", 9+/10-) turning them clockwise to lock them in position.

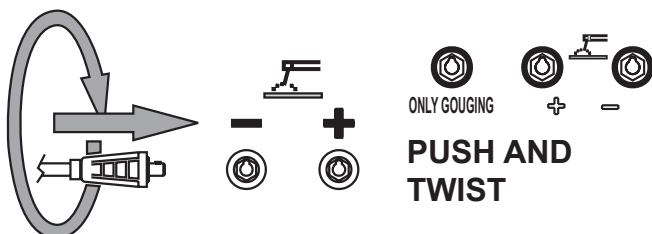

Make sure that the ground clamp, whose cable must be connected to the + or - terminal, depending on the type of electrode, makes a good connection and is near to the welding position.

Pay attention to the two polarities of the welding circuit, which must not come in electric contact between themselves.

When using the welder for air arc gouging connect the ground lead to the - socket and the gouging lead to the socket marked "only gouging" (if present).



REMOTE CONTROL TC...

See page M 38

WELDING CURRENT REGULATION KNOB

Position knob (T) in correspondance of the chosen current value, so as to obtain the necessary amperage, taking into account the diameter and the type of the electrode.

For technical data see page M1.6.



ATTENTION

To reduce the risk of electromagnetic interferences, use the minimum length of welding cables and keep them near and down (ex. on the floor).

The welding operations must take place far from any sensitive electronic device. Make sure that the unit is earthed (see M20 and/or M25). In case the interference should last, adapt further disposition, such as: move the unit, use screened cables, line filters, screen the entire work area.

In case the above mentioned operations are non sufficient, please contact our Technical Assistance Service.



CAUTION

With a welding cable length up to 20 m is suggested a section of 35 mm²; with longer cables a bigger section is required.



REDUCTION SCALE

100%
Ⓢ
A
max

For small electrodes (up to Ø 3.25-130A and 4-200A) it is recommended to use the reduction scale switch (I3) allowing a more accurate regulation of the welding current (lever position at 130 A and/or 200A).

When using electrodes of a diameter greater than 3.25 and/or 4 set the welding scale knob to 100% and/or max. position.

Protection fuse:



he fuse protects the electronic welding PCB in case the remote control is short circuited.

POLARITY INVERTER (PL VERSION)

It permits to have at the electrode holder the positive or negative polarity of the welding diode bridge.




Polarity
switch

It is used above all in the first run with cellulosic electrodes to lower the bath temperature and so doing ease up the welding on pipes of small thickness

BASIC CURRENT "BC"

Positioning the switch on „ON“, is obtained a low voltage welding current which keeps, always, the lit arc necessary for some types of cellulosic electrodes or when a high penetration is wanted.

 **It is strictly forbidden to connect the group to the public mains a/o to another source of electric power.**



WARNING


Sockets are not **self-locked**: tension is available immediately after starting also with no plug.



WARNING

The areas, **access** of which is forbidden to un-qualified personel, are:

- the control switchboard (front), the exhaust of the endothermic engine

 At the beginning of every work, check the electric parameters and/or the controls placed on the front.

Make sure the unit is properly grounded (12) (where it is assembled).

the voltmeter (N) shows the single-phase voltage whether three or single-phase current has to be drawn.

Nominal voltage	no-load voltage
110V	-0 +10%
230V	-0 +10%
230V	-0 +10%
400V	-0 +10%

Connect up the machine, using proper plugs and cables in good condition to the AC socket (15) to draw single or three-phase power.

 
Using several sockets at the same time, the maximum power possible is that indicated on the data plate.

To draw power simultaneously, see page M52.
The max. continuous power of the generating set or the load current must not be exceeded.

THERMOPROTECTION

If you overload the genset the thermoprotection will automatically switch off.

If the thermoprotection is released, disconnect all the connected loads.



CIRCUIT BREAKER



Reset the thermoprotection pressing the central pole.

When reset, connect the

loads again.

In case the protection should act furtherly, check: the connections, the wires or others, and if necessary call the Assistance Service.

Avoid to hold the central pole of the thermoprotection pressed for a long time.

Otherwise, in case of trouble, it will not click, **damaging** the generating set.


TS ... PL VERSION

Start the machine.

The voltmeter will show the auxiliary voltage which, for machines at 1500/1800 RPM, must be approx. $\approx 230V \pm 10\%$.

Push upwards the lever of Ground Fault Interrupter


GROUND FAULT INTERRUPTER SWITCH (GFI)

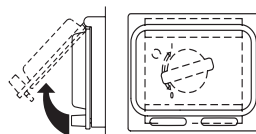

Turn on the GFI safety-switch (D) by pushing it upwards.

The GFI is a safety device which protects the circuit in the event of a malfunction. In this case the switch disconnects the three and single-phase circuit when in any part of the electric connections a current leakage of more than 30 mA occurs.



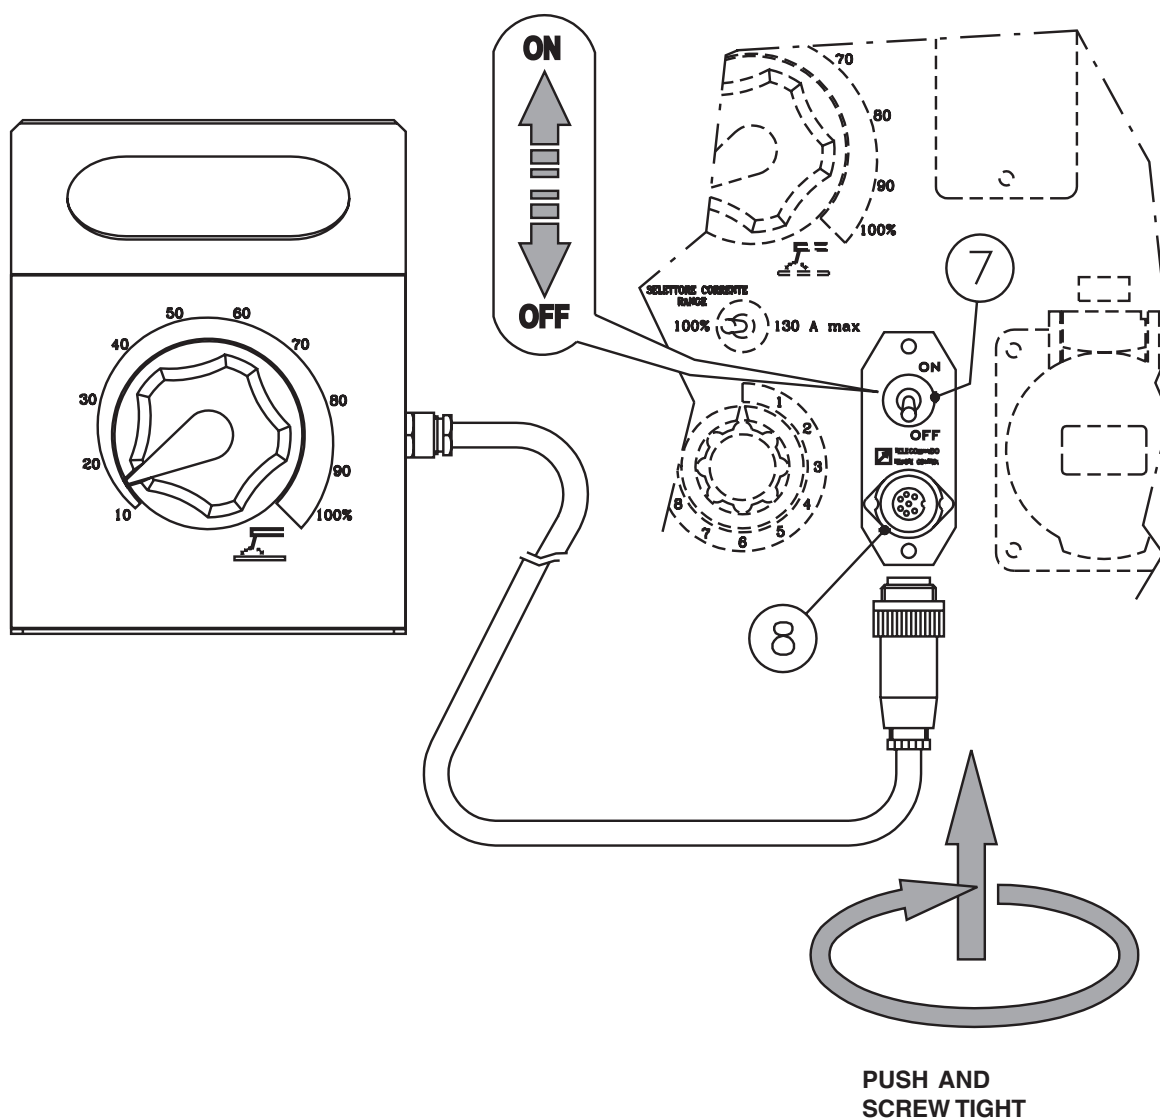

The remote control device for regulating the welding current is connected to the front panel by means of a multipole connector.

To regulate the current from the TC2 / TC2/50, move the switch (7), located above the multipole connector (8), to "ON" position.

Position welding current adjusting (T) knob at the necessary current value for the diameter and type of electrode.

- See page M51 -

ENGINE PROTECTION (ES - EV)

The devices ES or EV ensure the protection of the engine in case of low oil pressure or engine high temperature.


The system consist of electronic card of control and check, and of an engine stop device: solenoid (**ElettroStop**), electrovalve (**ElettroValvola**)

The device enter in operation when the engine starts and, in case of low oil pressure and high temperature, will stop the machine and show the cause of the stop with the warning light of high temperature or low oil pressure.

In case of low oil pressure, check the level and if it is correct, call the Service Station. In case of high temperature, make sure that there are no leaves and/or pieces of material obstructing the air ducts.

N.B.: if the unit is used as a generator in hot climates and with loads near to the maximum, the protection device can be triggered off, please reduce the load of the engine.

Once the cause of the problem is removed, to reset the protection, it is enough to report the ignition key (Q1) on "OFF" position and start the engine again.

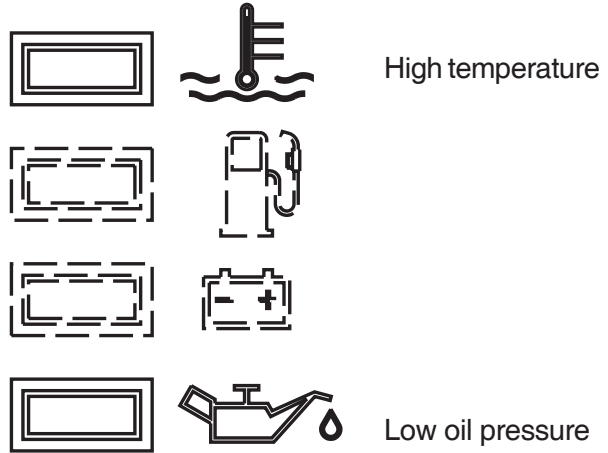

NOTE

THE ENGINE PROTECTIONS DO NOT WORK WHEN THE OIL IS OF LOW QUALITY BECAUSE NOT CHANGED REGULARLY AT INTERVALS AS PRESCRIBED IN THE OWNER'S ENGINE MANUAL.

<i>Problems</i>	<i>Possible cause</i>	<i>Solution</i>
WELDING		
P1 No welding current but auxiliary output is OK	1) Position of remote control switch 2) Potentiometer defect in welding current control 3) Welding current signal interrupter 4) Defect card 5) Defect in diode bridge	1) Check that it is in OFF position if there is no remote control or in "ON" position with remote control inserted. 2) Check the continuity of the welding potentiometer and relative connections. 3) Check that cables from shunt to card are in perfect state. 4) Replace card. 5) Check the diode or the controlled diodes.
P2 There is welding but non penetration	1) Connection of base current control are open 2) Defect in the base current contactor	1) Check that the a.c. 48V arrives to the contactor of the base current. 2) Check that the contacts and the contactor shut are in good conditions.
P3 Defect in welding, high and discontinued sparks	1) Defect in connections between shunt and potentiometer 2) Defect in diode bridge 3) Defect in card	1) Check the continuity and the state of different connections which go to the card from the shunt as well as from the potentiometer. 2) Check the diodes and SCR. 3) Replace the card.
P4 No welding output and no auxiliary power output	1) Short circuit in wiring 2) Defective condenser 3) Defective stator 4) Short circuited diode bridge	1) Check the wiring inside the welder for a short circuit between cables or to ground. 2) If the wiring is OK, short circuit the condenser to be sure that it is discharged, disconnect all wires from condenser and, using an ohmmeter, check that the condenser is not short circuited. 3) If the condenser box is OK, disconnect all leads from the stator except for those going to the condenser box and check the output from the alternator. If there is no output from the welding winding and the auxiliary winding, replace the stator. 4) If there is output from all windings reconnect the diode bridge and check if there is welding current. If not the diode bridge is defective. If there is welding current connect the auxiliary power leads one at a time until there is no output; at this point, the short circuit is in that line..
GENERATING		
P1 Voltmeter shows no voltage or low voltage but actual voltage at the sockets is OK.	1) Voltmeter malfunction	1) Replace the voltmeter.
P2 No three-phase voltage present at the socket(s) but voltmeter reading is normal and there is voltage on the other sockets.	1) Differential switch not inserted 2) Differential switch malfunction	1) Turn on the differential switch. 2) Replace the differential switch.
P3 No single phase voltage one socket but voltmeter reading is normal and there is voltage on the other sockets.	1) Intervention of thermal switch due to excessive current. 2) Thermal switch malfunction.	1) Push in the thermal switch. 2) Replace the thermal switch.
P4 No voltage present.	1) Short circuit present on the generator outputs.	1) Disconnect all outputs on the generator except for those on the condensers and re-start machine; check for voltage on condensers.

<i>Problems</i>	<i>Possible cause</i>	<i>Solution</i>
ENGINE		
P1 The engine does not start or stops immediately after startup.	1) Low battery voltage, battery dead or defective. 2) Presence of air in the fuel supply circuit. 3) Engine protection thermic/fuse blown	1) Check the warning light "state of the battery": - Green colour: battery OK - Black colour: battery to be recharged - White colour: battery to be replaced - DO NOT OPEN THE BATTERY. 2) Carry out de-aeration on the fuel system. See engine operating manual. 3) Replace. In case the problem persists, check the electrical circuit and eliminate the problem. Call an authorised service centre.
P2 Engine stop due to intervention of engine protection	1) Engine temperature too high or insufficient oil pressure. 2) High temperature sensor or oil pressure defective. 3) Engine protection defective. 4) Stop device defective.	1) Check oil level. 2) Replace the malfunctioning sensor. 3) Replace the protection. 4) Replace
P3 The battery is not charged	1) Battery charger alternator defective. 2) Battery charger alternator not excited.	1) Replace 2) Check the excitation system of battery charger.
P4 For other problems, refer to the attached engine manual		



WARNING



**MOVING
PARTS
can injure**

- Have **qualified** personnel do maintenance and troubleshooting work.
- Stop the engine before doing any work inside the machine. If for any reason the machine must be operated while working inside, **pay attention** moving parts, hot parts (exhaust manifold and muffler, etc.) electrical parts which may be unprotected when the machine is open.
 - Remove guards only when necessary to perform maintenance, and replace them when the maintenance requiring their removal is complete.
 - Use suitable tools and clothes.
 - Do not modify the components if not authorized.
- See pag. M1.1 -



**HOT surface
can
hurt you**

NOTE

By maintenance at care of the utilizer we intend all the operatios concerning the verification of mechanical parts, electrical parts and of the fluids subject to use or consumption during the normal operation of the machine.

For what concerns the fluids we must consider as maintenance even the periodical change and or the refills eventually necessary.

Maintenance operations also include machine cleaning operations when carried out on a periodic basis outside of the normal work cycle.

The repairs **cannot be considered** among the maintenance activities, i.e. the replacement of parts subject to occasional damages and the replacement of electric and mechanic components consumed in normal use, by the Assistance Authorized Center as well as by MOSA.

The replacement of tires (for machines equipped with trolleys) must be considered as repair since it is not delivered as standard equipment any lifting system.

The periodic maintenance should be performed according to the schedule shown in the engine manual. An optional hour counter (M) is available to simplify the determination of the working hours.



IMPORTANT



In the maintenance operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroundings, health or safety respecting completely the laws and/or dispositions in force in the place.

ENGINE and ALTERNATOR

PLEASE REFER TO THE SPECIFIC MANUALS PROVIDED.

Every engine and alternator manufacturer has

maintenance intervals and specific checks for each model: it is necessary to consult the specific engine or alternator USER AND MAINTENANCE manual.

VENTILATION

Make certain there are no obstructions (rags, leaves or other) in the air inlet and outlet openings on the machine, alternator and motor.

ELECTRICAL PANELS

Check condition of cables and connections daily. Clean periodically using a vacuum cleaner, **DO NOT USE COMPRESSED AIR.**

DECALS AND LABELS

*All warning and decals should be checked once a year and **replaced** if missing or unreadable.*

STRENUOUS OPERATING CONDITIONS

Under extreme operating conditions (frequent stops and starts, dusty environment, cold weather, extended periods of no load operation, fuel with over 0.5% sulphur content) do maintenance more frequently.

BATTERY WITHOUT MAINTENANCE DO NOT OPEN THE BATTERY

The battery is charged automatically from the battery charger circuit supplied with the engine.

Check the state of the battery from the colour of the warning light which is in the upper part.

- Green colour: battery OK
- Black colour: battery to be recharged
- White colour: battery to be replaced



NOTE

THE ENGINE PROTECTION NOT WORK WHEN THE OIL IS OF LOW QUALITY BECAUSE NOT CHARGED REGULARLY AT INTERVALS AS PRESCRIBED IN THE OWNER'S ENGINE MANUAL.

A	B	C	D	E	F	HOW IT WORKS
●						Check the level of the coolant
	●					Check the concentration of the coolant (1)
	●					Check the tension and the state of the driving belt
			●			Replace the control belt of the alternator
●						Drain the water from the prefilter (if assembled)
		●				Replace the cartridge of the fuel filter
					●	Check the efficiency of the injectors (2)
●						Check the level of the lubricating oil
		●				Change the lubricating oil of the engine (fill slowly, make shure the right quantity is used) (3)
		●				Replace the engine oil filter
●						Clean the air filter and empty the dust gathering cup of the air filter in very dusty conditions
		●				Clean the air filter and empty the dust gathering cup of the air filter in very dusty conditions
						Clean the housing of the rotor in the turboblower and the housing of the compressor in the turboblower (2)
			●			Check the valve clearance of the engine and set it up if necessary (2)
			●			Check all hoses and connectors
				●		Replace the engine breather pipe
				●		Check the alternator, the starting motor (2)
				●		Inspect the electrical plant to see that the wires are well firm and not worm out
●						Check and repair any loss or damage at the engine

PROGRAMS

The interventions listed below must be effected at the intervals (hours and months) in the chronologie order

- | | |
|---|---------------------------|
| A every day or every 8 hours | D every 1000 hours |
| B every 250 hours or every 6 months | E every 2000 hours |
| C every 500 hours or every 12 months | F every 3000 hours |

- (1) Replace the antifreeze every 2 years. If instead of antifreeze, anticorrosive is used in the coolant, replace it every 6 months. Make sure you use the right quantity.
- (2) By well trained staff.
- (3) The interval for changing oil must be modified if the load factor of the engine is above 40% or if a specifically wrong oil is used. If you are not sure how to calculate the load factor for said application, please turn to the Assistance Centre.

In case the machine should not be used for more than 30 days, make sure that the room in which it is stored presents a suitable shelter from heat sources, weather changes or anything which can cause rust, corrosion or damages to the machine.

☞ Have **qualified** personnel prepare the machine for storage.

GASOLINE ENGINE

Start the engine: It will run until it stops due to the lack of fuel.

Drain the oil from the engine sump and fill it with new oil (see page M25).

Pour about 10 cc of oil into the spark plug hole and screw the spark plug, after having rotated the crankshaft several times.

Rotate the crankshaft slowly until you feel a certain compression, then leave it.

In case the battery, for the electric start, is assembled, disconnect it.

Clean the covers and all the other parts of the machine carefully.

Protect the machine with a plastic hood and store it in a dry place.

DIESEL ENGINE

For short periods of time it is advisable, about every 10 days, to make the machine work with load for 15-30 minutes, for a correct distribution of the lubricant, to recharge the battery and to prevent any possible blocking of the injection system.

For long periods of inactivity, turn to the after sales service of the engine manufacturer.

Clean the covers and all the other parts of the machine carefully.

Protect the machine with a plastic hood and store it in a dry place.

In case of necessity for first aid and of fire prevention, see page. M2.5.



IMPORTANT



In the storage operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroundings, health or safety respecting completely the laws and/or dispositions in force in the place.

✎ Have **qualified** personnel disassemble the machine and dispose of the parts, including the oil, fuel, etc., in a correct manner when it is to be taken out of service.

In case of necessity for first aid and fire prevention, see page M2.5.

As cust off we intend all operations to be made, at utilizer's care, at the end of the use of the machine. This comprises the dismantling of the machine, the subdivision of the several components for a further reutilization or for getting rid of them, the eventual packing and transportation of the eliminated parts up to their delivery to the store, or to the bureau encharged to the cust off or to the storage office, etc.

The several operations concerning the cust off, involve the manipulation of fluids potentially dangerous such as: lubricating oil and battery electrolyte.

The dismantling of metallic parts liable to cause injuries or wounds, must be made wearing heavy gloves and using suitable tools.

The getting rid of the various components of the machine must be made accordingly to rules in force of law a/o local rules.

Particular attention must be paid when getting rid of:

lubricating oils, battery electrolyte, and inflammable liquids such as fuel, cooling liquid.

The machine user is responsible for the observance of the norms concerning the environment conditions with regard to the elimination of the machine being cust off and of all its components.

In case the machine should be cust off without any previous disassembly it is however compulsory to remove:

- tank fuel
- engine lubricating oil
- cooling liquid from the engine
- battery




NOTE: BCS is involved with custing off the machine **only** for the second hand ones, when not reparable. This, of course, after authorization.



IMPORTANT



In the cust-off operations avoid that polluting substances, liquids, exhausted oils, etc. bring damage to people or things or can cause negative effects to surroundings, health or safety respecting completely the laws and/or dispositions in force in the place.

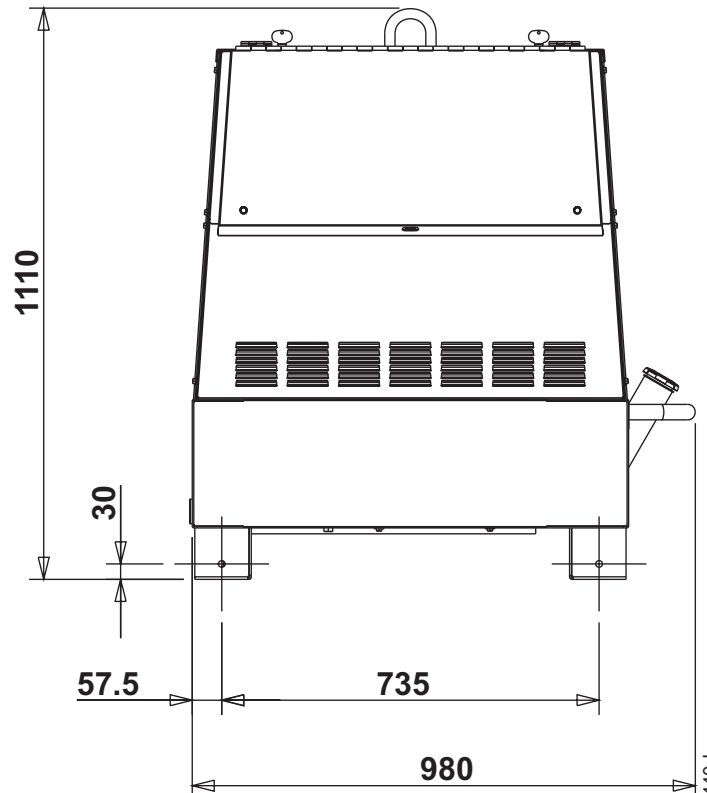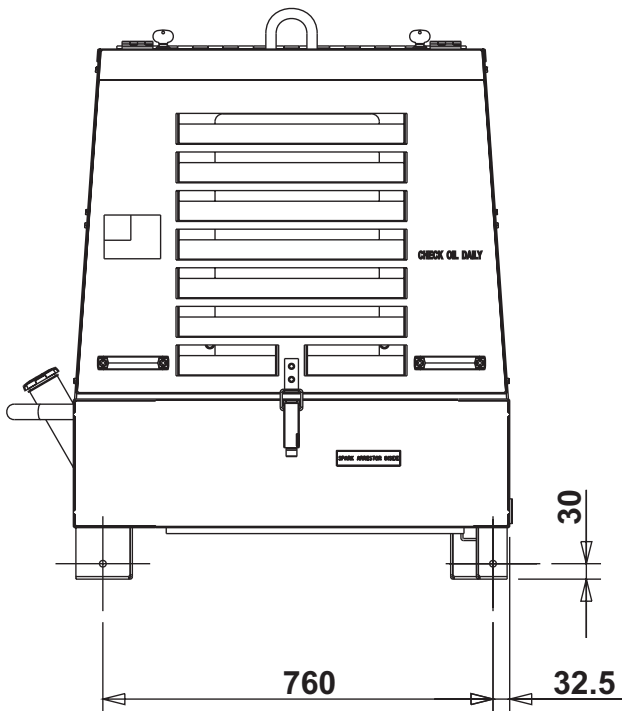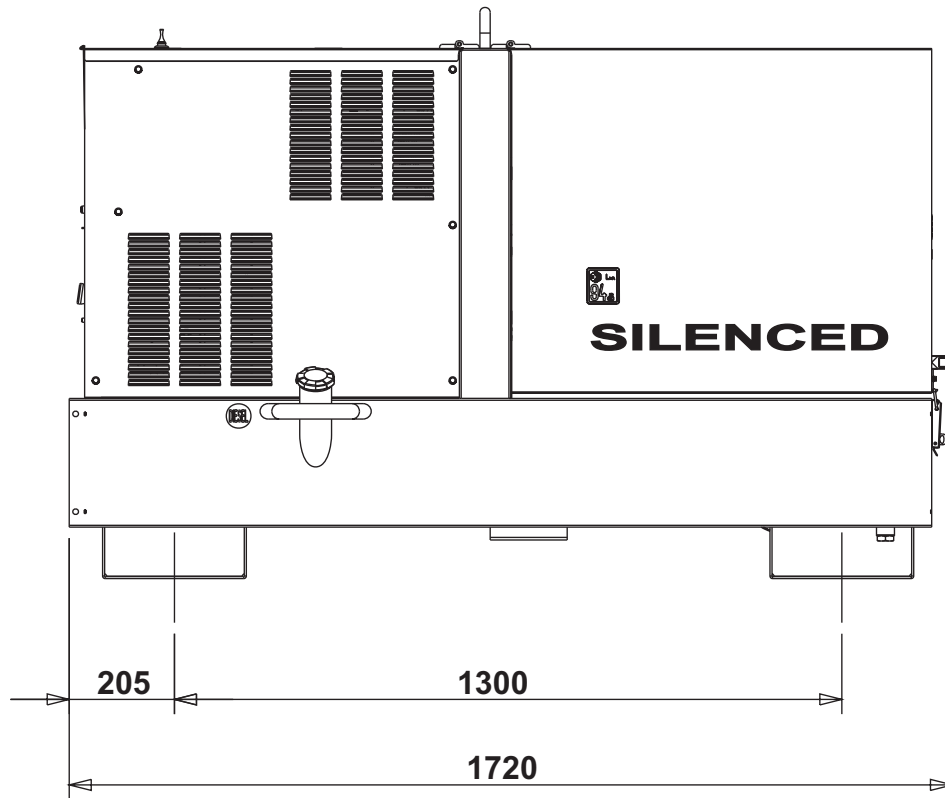

The information here below are to be intended only as indicative since the above norm is much larger.
For further details please see the specific norms and/or the manufacturers of the product to be used in the welding process.

RUTILE ELECTRODES: E 6013

Easily removable fluid slag, suitable for welding in all position.
Rutile electrodes weld in d.c. with both polarities (electrode holder at + or -) and in a.c..
Suitable for soft steels R-38/45 kg/mm². Also for soft steels of lower quality.

BASIC ELECTRODES: E 7015

Basic electrodes weld only in d.c. with inverse polarity (+ on the electrode holder) ; there are also types for a.c.
Suitable for impure carbon steels. Weld in all position.


HIGH YIELD BASIC ELECTRODES: E 7018

The iron contained in the coating increases the quality of metal added. Good mechanical properties. Weld in all position.
Electrode holder at + (inverse polarity). Weld deposit of nice aspect, also vertical. Workable; high yield.
Suitable for steels with high contents of sulphur (impurities).

CELLULOSIC ELECTRODES: E 6010

Cellulosic electrodes weld only in d.c. with polarity + electrode holder - ground clamp.
Special for steels run on pipes with R max 55 kg/mm². Weld in all position. volatile slag.

ELECTRODES IDENTIFICATION ACCORDING TO A.W.S. STANDARDS

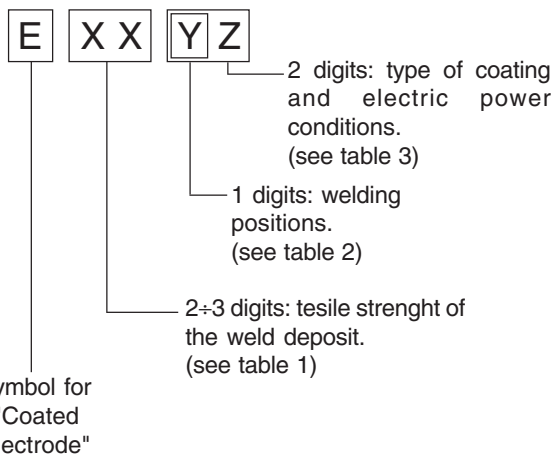

Number	Strength	
	K.s.l.	Kg/mm ²
60	60.000	42
70	70.000	49
80	80.000	56
90	90.000	63
100	100.000	70
110	110.000	77
120	120.000	84

Table 1


1	for all positions
2	for plane and vertical
3	for plane position only

Table 2

N°	Descrizione
10	Cellulose electrodes for d.c.
11	Cellulose electrodes for a.c.
12	Rutile electrode for d.c.
13	Rutile electrode for a.c.
14	High yield rutile electrodes
15	Basic electrodes for d.c.
16	Basic electrodes for a.c.
18	High yield basic electrodes for d.c. (inverse polarity)
20	Acid electrodes for flat or front position welding for d.c. (- pole) and for a.c.
24	High yield rutile electrodes for flat or front plane position welding for d.c. and a.c.
27	High yield acid electrodes for flat or front plane position welding for d.c. (- pole) and a.c..
28	High yield basic electrodes for flat or front plane position welding for d.c. (inverse polarity)
30	Extra high yield acid electrodes, extra high penetration if required, for flat position welding only for d.c. (- pole) and a.c.

Table 3


A: Alternator	A3: Insulation monitoring	A6: Commutator/switch
B: Wire connection unit	B3: E.A.S. connector	B6: Key switch, on/off
C: Capacitor	C3: E.A.S. PCB	C6: QEA control unit
D: G.F.I.	D3: Booster socket	D6: Connector, PAC
E: Welding PCB transformer	E3: Open circuit voltage switch	E6: Frequency rpm regulator
F: Fuse	F3: Stop push-button	F6: Arc-Force selector
G: 400V 3-phase socket	G3: Ignition coil	G6: Device starting motor
H: 230V 1phase socket	H3: Spark plug	H6: Fuel electro pump 12V c.c.
I: 110V 1-phase socket	I3: Range switch	I6: Start Local/Remote selector
L: Socket warning light	L3: Oil shut-down button	L6: Choke button
M: Hour-counter	M3: Battery charge diode	M6: Switch CC/CV
N: Voltmeter	N3: Relay	N6: Connector – wire feeder
P: Welding arc regulator	O3: Resistor	O6: 420V/110V 3-phase transformer
Q: 230V 3-phase socket	P3: Sparkler reactor	P6: Switch IDLE/RUN
R: Welding control PCB	Q3: Output power unit	Q6: Hz/V/A analogic instrument
S: Welding current ammeter	R3: Electric siren	R6: EMC filter
T: Welding current regulator	S3: E.P.4 engine protection	S6: Wire feeder supply switch
U: Current transformer	T3: Engine control PCB	T6: Wire feeder socket
V: Welding voltage voltmeter	U3: R.P.M. electronic regulator	U6: DSP chopper PCB
Z: Welding sockets	V3: PTO HI control PCB	V6: Power chopper supply PCB
X: Shunt	Z3: PTO HI 20 l/min push-button	Z6: Switch and leds PCB
W: D.C. inductor	W3: PTO HI 30 l/min push-button	W6: Hall sensor
Y: Welding diode bridge	X3: PTO HI reset push-button	X6: Water heater indicator
	Y3: PTO HI 20 l/min indicator	Y6: Battery charge indicator
A1: Arc striking resistor	A4: PTO HI 30 l/min indicator	A7: Transfer pump selector AUT-0-MAN
B1: Arc striking circuit	B4: PTO HI reset indicator	B7: Fuel transfer pump
C1: 110V D.C./48V D.C. diode bridge	C4: PTO HI 20 l/min solenoid valve	C7: „GECO“ generating set test
D1: E.P.1 engine protection	D4: PTO HI 30 l/min solenoid valve	D7: Flooting with level switches
E1: Engine stop solenoid	E4: Hydraulic oil pressure switch	E7: Voltmeter regulator
F1: Acceleration solenoid	F4: Hydraulic oil level gauge	F7: WELD/AUX switch
G1: Fuel level transmitter	G4: Preheating glow plugs	G7: Reactor, 3-phase
H1: Oil or water thermostat	H4: Preheating gearbox	H7: Switch disconnecter
I1: 48V D.C. socket	I4: Preheating indicator	I7: Solenoid stop timer
L1: Oil pressure switch	L4: R.C. filter	L7: "VODIA" connector
M1: Fuel warning light	M4: Heater with thermostat	M7: "F" EDC4 connector
N1: Battery charge warning light	N4: Choke solenoid	N7: OFF-ON-DIAGN. selector
O1: Oil pressure warning light	O4: Step relay	O7: DIAGNOSTIC push-button
P1: Fuse	P4: Circuit breaker	P7: DIAGNOSTIC indicator
Q1: Starter key	Q4: Battery charge sockets	Q7: Welding selector mode
R1: Starter motor	R4: Sensor, cooling liquid temperature	R7: VRD load
S1: Battery	S4: Sensor, air filter clogging	S7: 230V 1-phase plug
T1: Battery charge alternator	T4: Warning light, air filter clogging	T7: V/Hz analogic instrument
U1: Battery charge voltage regulator	U4: Polarity inverter remote control	U7: Engine protection EP6
V1: Solenoid valve control PCBT	V4: Polarity inverter switch	V7: G.F.I. relay supply switch
Z1: Solenoid valve	Z4: Transformer 230/48V	Z7: Radio remote control receiver
W1: Remote control switch	W4: Diode bridge, polarity change	W7: Radio remote control transmitter
X1: Remote control and/or wire feeder socket	X4: Base current diode bridge	X7: Isometer test push-button
Y1: Remote control plug	Y4: PCB control unit, polarity inverter	Y7: Remote start socket
A2: Remote control welding regulator	A5: Base current switch	A8: Transfer fuel pump control
B2: E.P.2 engine protection	B5: Auxiliary push-button ON/OFF	B8: Ammeter selector switch
C2: Fuel level gauge	C5: Accelerator electronic control	C8: 400V/230V/115V commutator
D2: Ammeter	D5: Actuator	D8: 50/60 Hz switch
E2: Frequency meter	E5: Pick-up	E8: Cold start advance with temp. switch
F2: Battery charge transformer	F5: Warning light, high temperature	F8: START/STOP switch
G2: Battery charge PCB	G5: Commutator auxiliary power	G8: Polarity inverter two way switch
H2: Voltage selector switch	H5: 24V diode bridge	H8: Engine protection EP7
I2: 48V a.c. socket	I5: Y/s commutator	I8: AUTOIDLE switch
L2: Thermal relay	L5: Emergency stop button	L8: AUTOIDLE PCB
M2: Contactor	M5: Engine protection EP5	M8: A4E2 ECM engine PCB
N2: G.F.I. and circuit breaker	N5: Pre-heat push-button	N8: Remote emergency stop connector
O2: 42V EEC socket	O5: Accelerator solenoid PCB	O8: V/A digital instruments and led VRD PCB
P2: G.F.I. resistor	P5: Oil pressure switch	P8: Water in fuel
Q2: T.E.P. engine protection	Q5: Water temperature switch	Q8:
R2: Solenoid control PCBT	R5: Water heater	R8:
S2: Oil level transmitter	S5: Engine connector 24 poles	S8:
T2: Engine stop push-button T.C.1	T5: Electronic GFI relays	T8:
U2: Engine start push-button T.C.1	U5: Release coil, circuit breaker	U8:
V2: 24V c.a. socket	V5: Oil pressure indicator	V8:
Z2: Thermal magnetic circuit breaker	Z5: Water temperature indicator	Z8:
W2: S.C.R. protection unit	W5: Battery voltmeter	W8:
X2: Remote control socket	X5: Contactor, polarity change	X8:
Y2: Remote control plug	Y5: Commutator/switch, series/parallel	Y8:

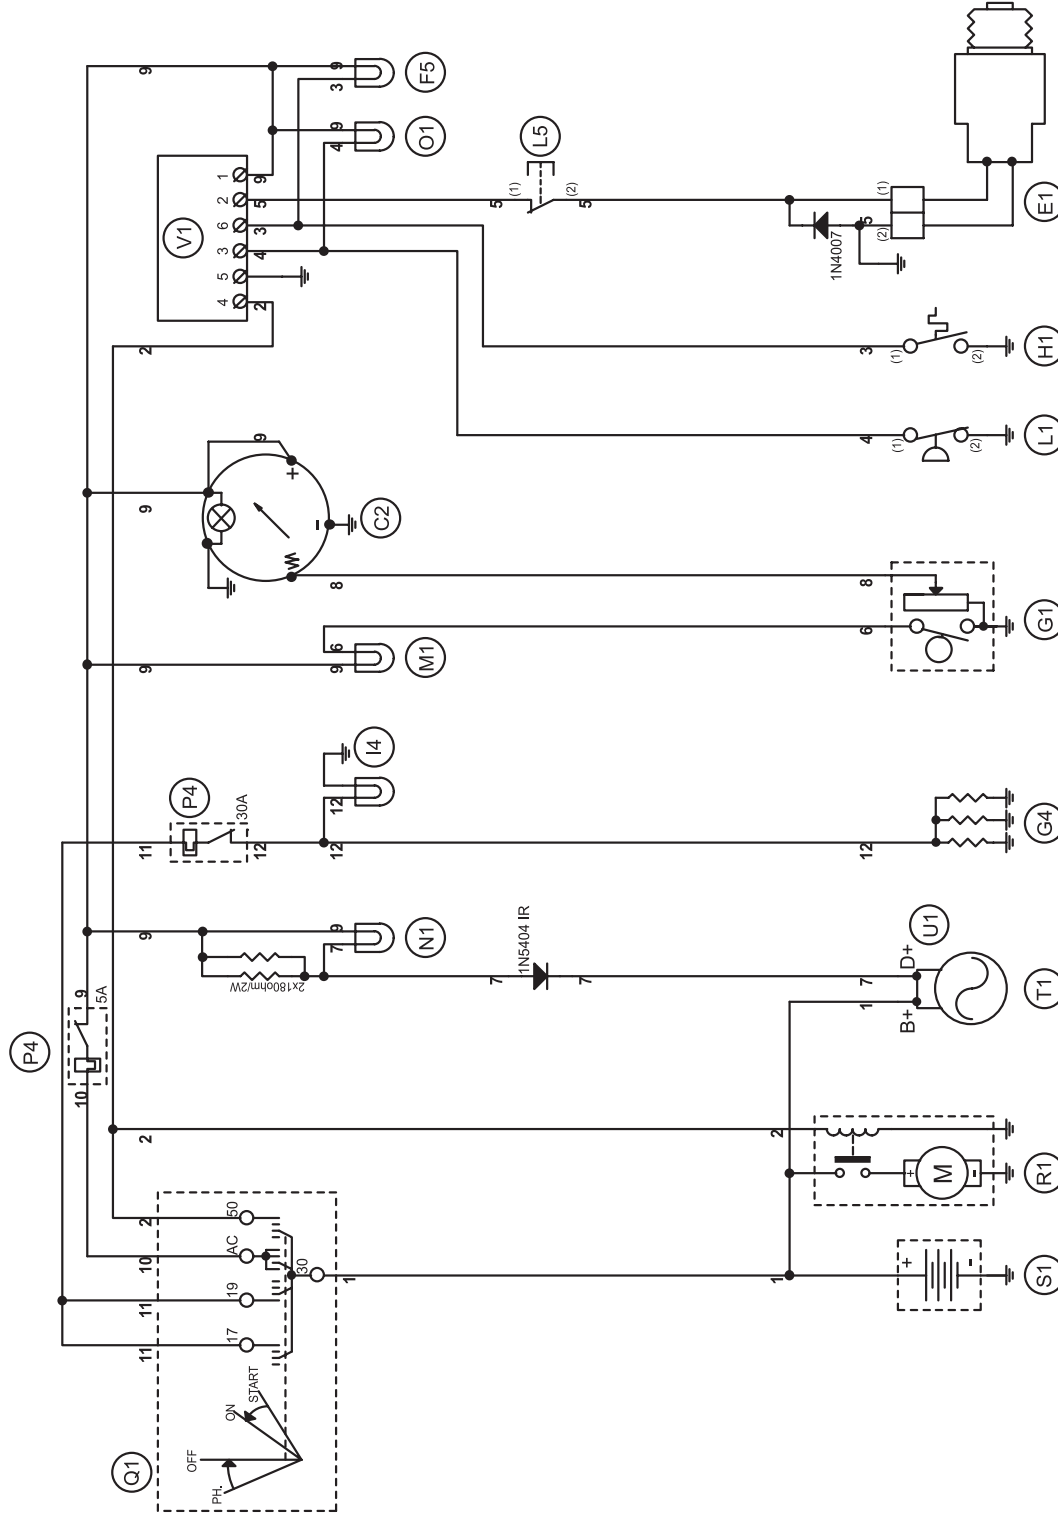

A		Modif. valore resistori spia C.B.(N1) per aumentare eccitaz. altern. C.B.(T1).		19.02.2008		L.N.	
Esq.	Modif.	Dis.	Dis.	Data	Dis.	Dis.	Dis.
500	1	1	1	19.02.2008	1	1	1
MOSA		Engine Perkins 404C-22G		76440.prg		2	
20090-CUSAGO (MI)-ITALY		Macchina: TS 400 PS-BC		Dis. n°: 76440.S.010-A		5	
http://www.mosa.it		Leporace N. 15.10.2004		Dis. n°: 76440.S.010-A		5	
		Disegnato: 15.10.2004		Dis. n°: 76440.S.010-A		5	
		Disegnato: 15.10.2004		Dis. n°: 76440.S.010-A		5	


La MOSA si riserva a termini di legge la proprietà del presente disegno con divieto di riproduzione o comunicazione a terzi senza sua autorizzazione.

STARTER KEY			
30	19	17	AC 50
PR	OFF	ON	ST

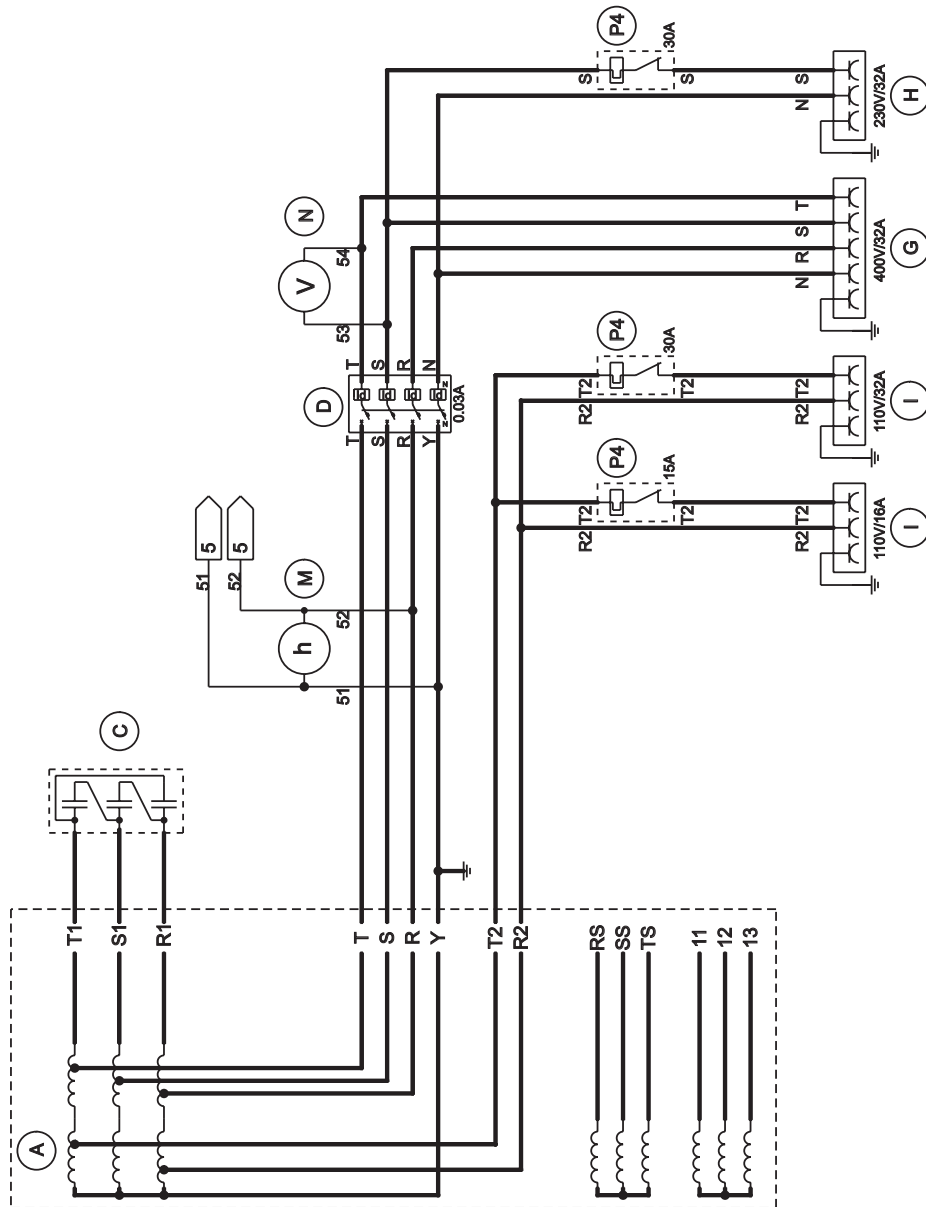


Exp. Exp.	Modifica Modification	Data Date	Dis. Desi.	Appr. Appr.
			Progetto: Project:	Pagin. Page n°
			76440.prg	3 5
			Dis. n°: Dwg. n°:	Approvato: Approved:
			76440.S.020	10/04/05
			Designatore: Designer:	
			Leporace N.	
			TS 400 PS-BC	
			Aux. (400T/230M/110CTEx2) DT	
			Macchine: Machine:	
			20090-CUSAGO (MI)-ITALY	
			http://www.mosa.it	


La MOSA si riserva a termini di legge la proprietà del presente disegno con divieto di riproduzione o comunicazione a terzi senza sua autorizzazione.

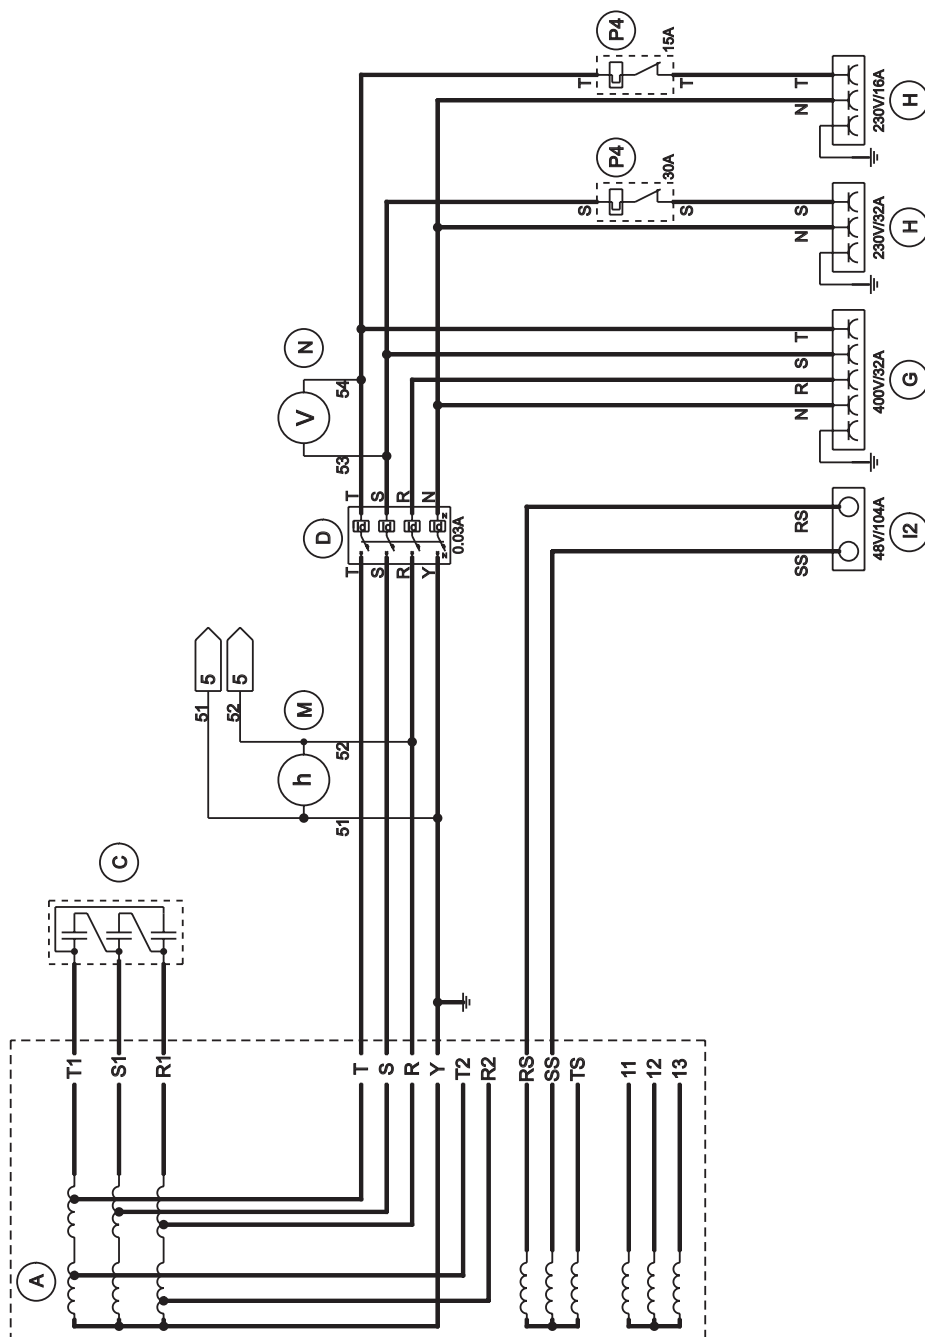



Exp. Exp.	Modifica Modification	Data Date	Dis. Desl.	Appr. Appr.
	Denominazione: Denomination:	Progetto: Project:	Pag. n° di n°	Pag. n° di n°
	Aux: (400T/230Mx2/48M) DT	76444.prg	3	5
	Alia Pag. To Page	Disegnatore: Designer:	Dis. n°: Dwg. n°:	Approvato: Approved:
	20090-CUSAGO (MI)-ITALY http://www.mosa.it	01.04.2005	76444.S.020	01.04.2005
	Macchina: Machine:	TS 400 PS-BC	Leporace N.	01.04.2005

La MOSA si riserva a termini di legge la proprietà del presente disegno con divieto di riproduzione o comunicazione a terzi senza sua autorizzazione.

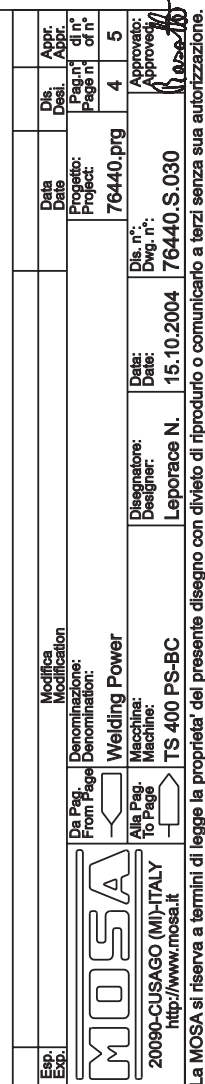

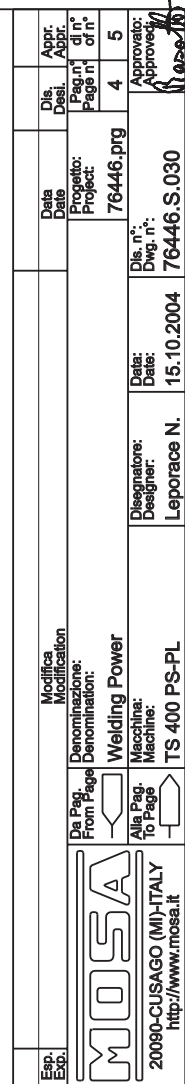


La MOSA si riserva a termini di legge la proprietà' del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.

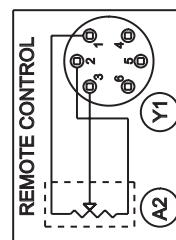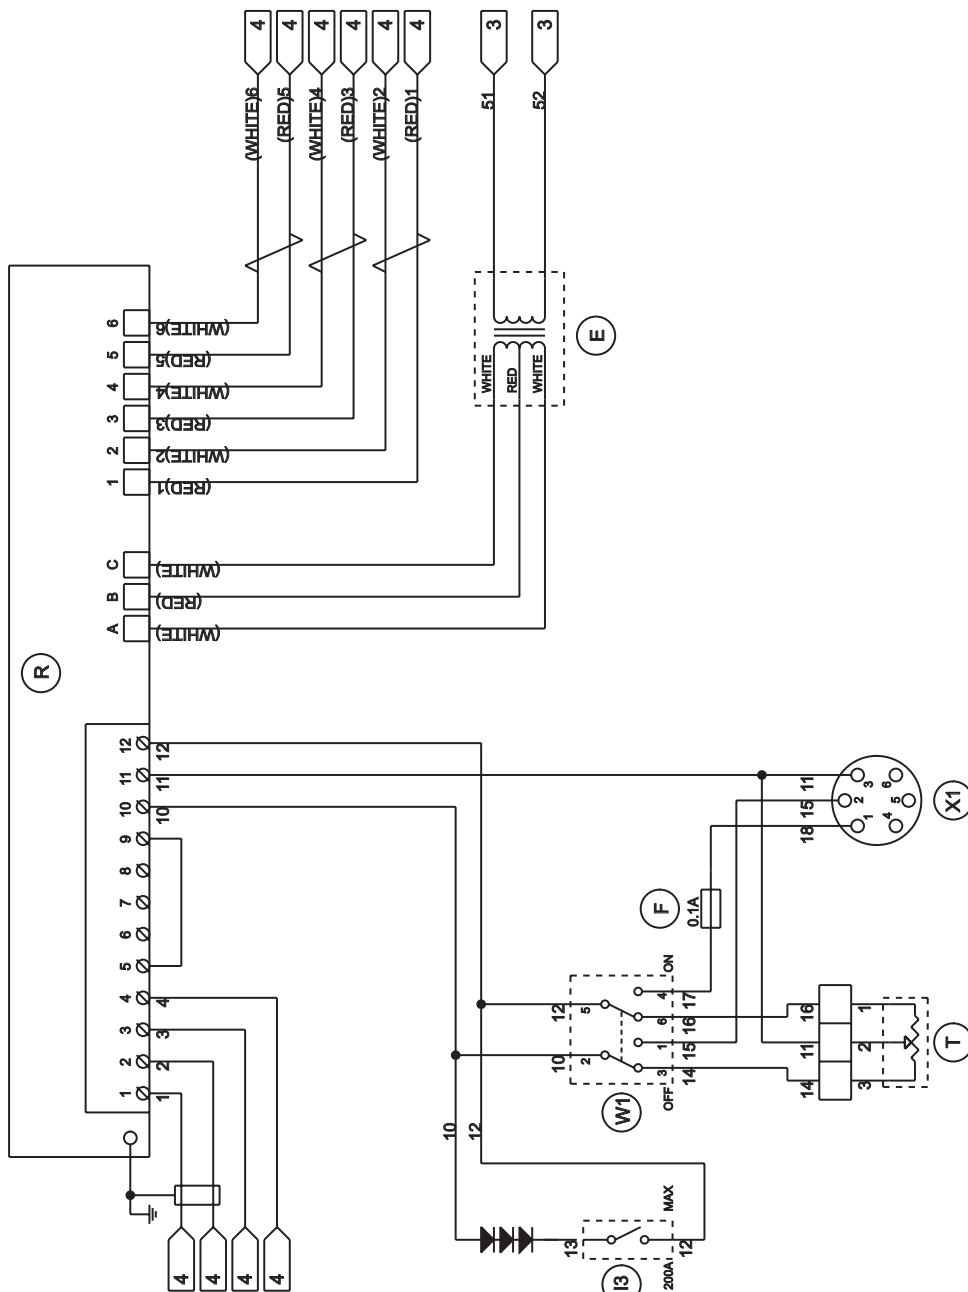

Exp. Exb.	Modifica	Da Pag. From	Da Pag. To	Denominazione: Denomination:	Data Date	Dis. n° Dwg. n°	Appr. n° of n°
				Welding Control	76440.prg	5	5
				Macchine: Machine:	15.10.2004	76440 S.040	Approvato: Approved:
				TS 400 PS-BC			
				Leporace N.			

La MOSA si riserva a termini di legge la proprietà del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.

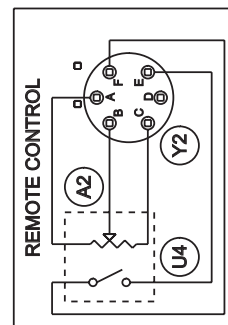[illegible]

reparto/minimale	100000	100000	100000	100000	100000
La MOSA si riserva a termini di legge la proprietà' del presente disegno con divieto di riprodurlo o comunicarlo a terzi senza sua autorizzazione.					

MOSA guarantees that any request for spare parts will be satisfied.

To keep the machine in full working order, when replacement of MOSA spare parts is required, always ask for genuine parts only.



✎ The requested data are to be found on the data plate located on the machine structure, quite visible and easy to consult. *

When ordering the spare parts, it is recommended to indicate:

- 1) * serial number
- 2) * model of welder and/or generating set
- 3) ♦ n. table
- 4) ♦ n. position
- 5) quantity


MOSA V.le Europa, 59 - 20090 CUSAGO (MI) ITALY
Tel. +39-02 90352.1 - fax +39-02 90390466

TS 0000 GE
SERIAL N° 0987654321

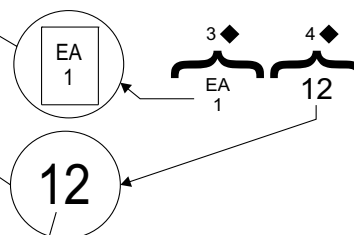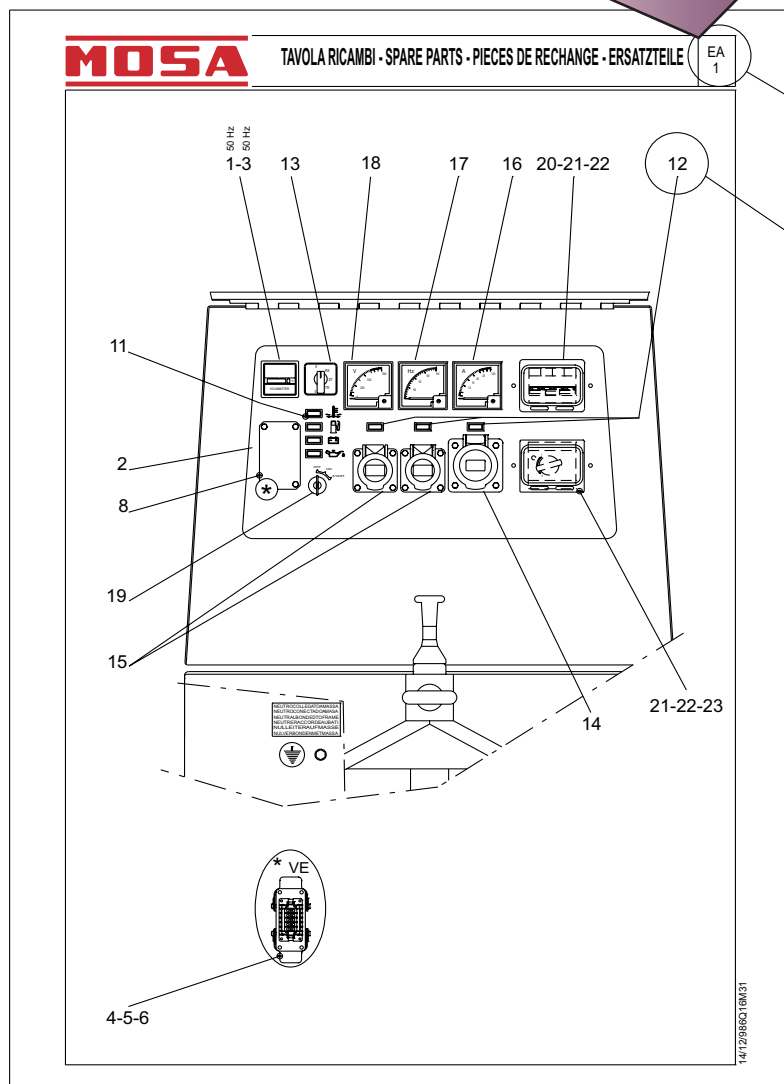

ABBREVIATIONS AND SYMBOLS:


- (EV) When ordering, specify the engine type and the auxiliary voltage
 (ER) Engine with recoil starter only
 (ES) Engine with electric starter only
 (VE) E.A.S version only.
 (QM) When ordering, specify the length in meters
 (VS) Special version only
 (SR) By request only

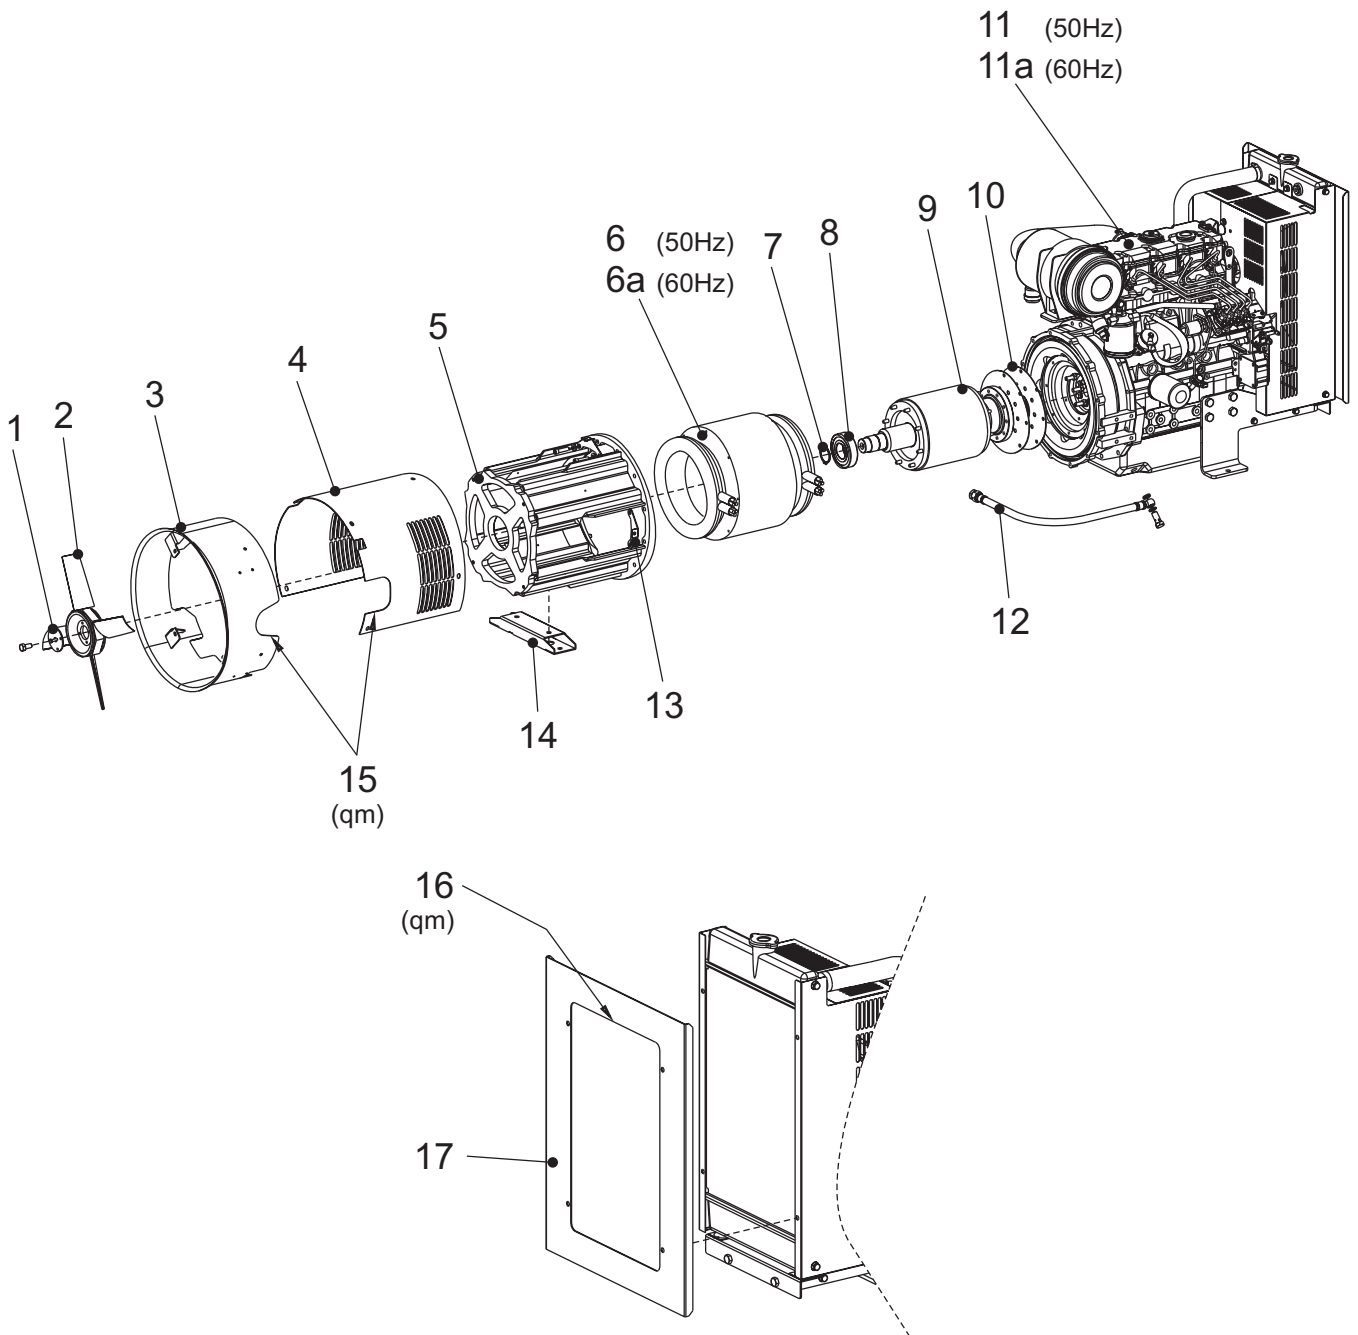


 © MOSA REV.1-06/08	I Ricambi	D Ersatzteile	TS 400 PS TS 500 PS	EG 1.1
	GB Spare parts	E Tabla de recambios		
	F Pièces de rechange	NL		

Pos.	Rev.	Cod.	Descr.	Note
1		M107301390	ANELLO	
2		M765006020	VENTOLA PER GENERATORE	
3		M307806010	CONVOGLIATORE GENERATORE	
4		M282008222	COPERTURA ALTERNATORE	
5		M764403010	CARCASSA STATORE	
6		M764403020	STATORE AVV. 400T230M110M CTE 50Hz	
6 a		M764423020	STATORE AVV. 400T230M110M CTE 60Hz	
7		M6050050	ANELLO SEEGER	
8		M1001050	CUSCINETTO	
9		M764403030	ALBERO ROTORE	
10		M773713012	DISCO ALBERO ROTORE	
11		M764402200	MOTORE PERKINS 404C-22G 50Hz	Fino a REV.0-04/05 Del.90/08-08/05/08
11		M764412200	MOTORE PERKINS 404D-22G 50Hz	Da REV.1-06/08 Del.90/08-08/05/08
11 a		M764422200	MOTORE PERKINS 404C-22G 60Hz	Fino a REV.0-04/05 Del.90/08-08/05/08
11 a		M764432200	MOTORE PERKINS 404D-22G 60Hz	Da REV.1-06/08 Del.90/08-08/05/08
12		M841562212	TUBO SCARICO OLIO	
13		M364108224	STAFFA	
14		M307803101	TRAVERSA ALTERNATORE	
15		M107509005	GUARNIZIONE	(qm)
16		M105112270	GUARNIZIONE (L=MT.1)	(qm)
17		M764408066	CORNICE RADIATORE	

Pos.	Rev.	Cod.	Descr.	Note
1		M107301390	RING FIXING FAN	
2		M765006020	ALTERNATOR FAN	
3		M307806010	GENERATOR CONVEYOR	
4		M282008222	COVER ALTERNATOR	
5		M764403010	HOUSING STATOR	
6		M764403020	STATOR 400T230M110M CTE 50Hz	
6 a		M764423020	STATOR 400T230M110M CTE 60Hz	
7		M6050050	RING, SEEGER	
8		M1001050	BEARING	
9		M764403030	SHAFT WITH ROTOR	
10		M773713012	SHAFT WITH ROTOR DISC	
11		M764402200	PERKINS ENGINE 404C-22G 50Hz	Up to REV.0-04/05 Del.90/08-08/05/08
11		M764412200	PERKINS ENGINE 404D-22G 50Hz	From REV.1-06/08 Del.90/08-08/05/08
11 a		M764422200	PERKINS ENGINE 404C-22G 60Hz	Up to REV.0-04/05 Del.90/08-08/05/08
11 a		M764422200	PERKINS ENGINE 404D-22G 60Hz	From REV.1-06/08 Del.90/08-08/05/08
12		M841562212	OIL EXHAUST TUBE	
13		M364108224	BRACKET	
14		M307803101	ALTERNATOR BRACKET	
15		M107509005	GASKET	(qm)
16		M105112270	STRIP, SEALING (L=MT.1)	(qm)
17		M764408066	RADIATOR FRAME	

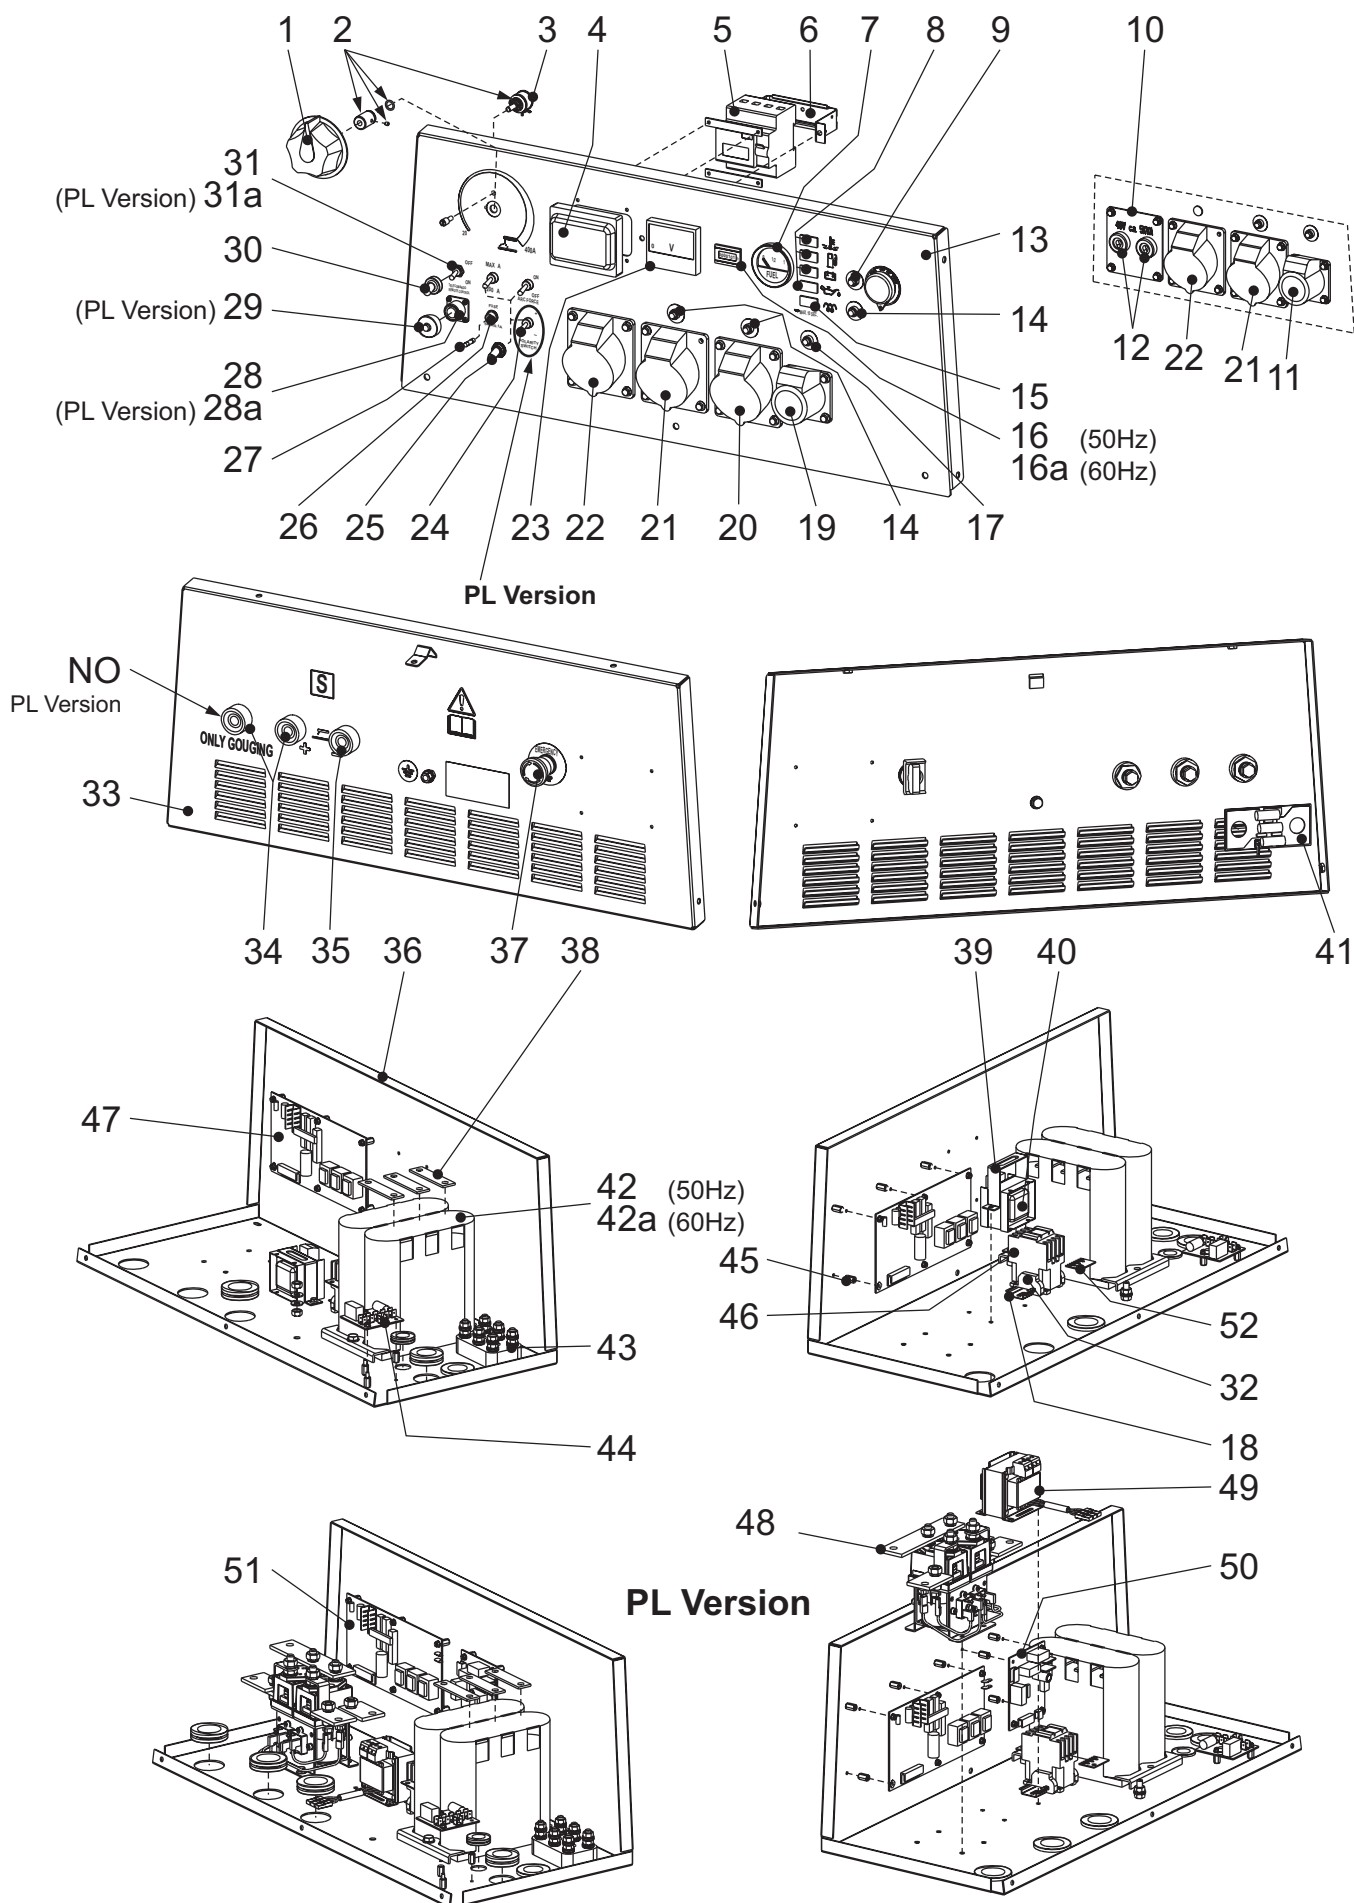


Pos.	Rev.	Cod.	Descr.	Note
1		M107509702	MANOPOLA REG. CORRENTE SALDAT./ KNOB, WELDING CURRENT REGULAT.	
2		M836709715	GR. POTENZIOMETRO / WELDING CURRENT REGULATOR GR.	
3		M0000836709701	POTENZIOMETRO COMPL./ WELDING CURRENT REGULATOR COMPL.	
4		M219937130	COPERCHIO INTERRU. DIFFERENZ. / COVER GFI	
5		M105111540	Vedi Cod. / See part no. 219937105	
6		M219937036	STAFFA / BRACKET	
7		M325507210	INDICATORE LIVELLO CARBURANTE / FUEL LEVEL GAUGE	
8		M1302040	SPIA ROSSA / RED WARNING LIGHT 12V	Fino a REV.0-04/05 Del.57/08-10/03/08
8		M1302500	SPIA ROSSA / RED WARNING LIGHT 12V	Da REV.1-06/08 Del.57/08-10/03/08
9		M352007109	PROTEZIONE TERMICA / THERMOPROTECTION 5A	
10		M107517032	COPERCHIO PRESE / BLIND PLATE, SOCKETS 48V	(400T230M48M Version)
11		M307017240	PRESA / EEC SOCKET 16A, 220V 2P+T	(400T230M48M Version)
12		M101131220	PRESA DINSE / SOCKET	(400T230M48M Version)
13		M764407020	PANNELLO FRONTALE (sup.) / FRONT PANEL	
14		M873407107	DISGIUNTORE TERMICO / CIRCUIT BREAKER 30A/250V	
15		M1302080	SPIA PER / WARNING LIGHT FOR 48V	Fino a REV.0-04/05 Del.57/08-10/03/08
15		M1302510	SPIA PER / WARNING LIGHT FOR 48V	Da REV.1-06/08 Del.57/08-10/03/08
16		M105511810	CONTAORE / HOURMETER 230V (50Hz) IP65	
16a		M205187330	CONTAORE / HOURMETER (60HZ)	
17		M155307107	DISGIUNTORE TERMICO / THERMAL SWITCH 15A-250V	
18		M1243020	GUIDA PER MORSETTIERA / TERMINAL GUIDE	
19		M307047250	PRESA CEE / EEC SOCKET 110V 16A 2 P + T	(400T230M110M Version)
20		M105111530	PRESA CEE / EEC SOCKET 32A 110V 2 P + T	(400T230M110M Version)
21		M105111520	PRESA CEE / EEC SOCKET 220V MONOF. / SINGLE-PH. 2+T	
22		M105111510	PRESA CEE / EEC SOCKET 380V TRIFASE / THREE-PH.	
23		M105111550	VOLTMETRO / VOLTMETER FS 500V	
24		M282009741	INTERRUTTORE UNIPOLARE 15A / UNIPOLAR SWITCH	
25		M282009962	CAPPUCCIO ISOLANTE x INTERRU. / CAP	
26		M307759045	PORTAFUSIBILE / FUSE HOLDER	
27		M1291250	FUSIBILE / FUSE	
28		M76440C042	GR. CAVI SEGNAI COMANDI(SALD) / CABLE SET, SIGNALS AND CONTROLS	
28a		M76446C042	GR. CAVI SEGNAI COMANDI(SALD) / CABLE SET, SIGNALS AND CONTROLS	(PL Version)
29		M317809911	CAPPUCCIO / CAP	(PL Version)
30		M102042740	CAPPUCCIO / CAP	
31		M102013290	COMMUTATORE / COMMUTATOR	
31a		M107509902	COMMUTATORE TRIPOLARE / TRIPOLAR SWITCH	(PL Version)
32		M1241010	PIASTRINA / PLATE	
33		M764407205	PANNELLO FRONTALE (inferiore) / FRONT PANEL	
34		M102301310	PRESA DI SALDATURA / WELDING SOCKET (+)	
35		M102044400	PRESA DI SALDATURA / WELDING SOCKET (-)	
36		M764407010	SCATOLA ELETTRICA / ELECTRIC BOX	
37		M744507219	PULSANTE STOP D'EMERGENZA / EMERGENCY PUSH BUTTON STOP	
38		M107509041	SBARRETTA BOX CONDENSATORI / CONNECTING PLATE-CAPACITOR BOX	
39		M209719882	STAFFA BOX CONDENSATORI / CAPACITOR BOX BRACKET	
40		M107509870	TRASFORMATORE / AUXILIARY TRANSFORMER	
41		M700409860	UNITA' FILTRO ANTIDISTURBI / ANTIJAMMING FILTER	
42		M307809880	BOX CONDENSATORI / CAPACITOR BOX 3X80 UF (50 Hz)	
42a		M105319880	BOX CONDENSATORI / CAPACITOR BOX (60 Hz)	
43		M105111830	MORSETTIERA / TERMINAL BOARD	
44		M209719850	SCHEDA / PCB EV/ES	
45		M282009807	DISTANZ. ISOLANTE PER SCHEDE / SPACER	
46		M866707220	TELERUTTORE / CONTACTOR 40A	
47		M208019800	SCHEDA DI CONTROLLO SALDATURA / PCB, WELDING CONTROL	
48		M0000866817420	TELERUT. INVERSIONE POLARITA' (COMPL.) / PLARITY CHANGE CONTACTOR	(PL Version)
49		MED0109870	TRASFORMATORE AUSILIARIA / AUXILIARY TRANSFORMER	(PL Version)
50		M366609690	SCHEDA COMANDO INVERT.POLARITA' / PCB POLARITY INVERTER	(PL Version)
51		M307709800	UNITA' CONTROLLO SALDATURA / WELDING CONTROL UNIT	
52		M317807212	PIASTRINA DI PARALLELO / PLATE	

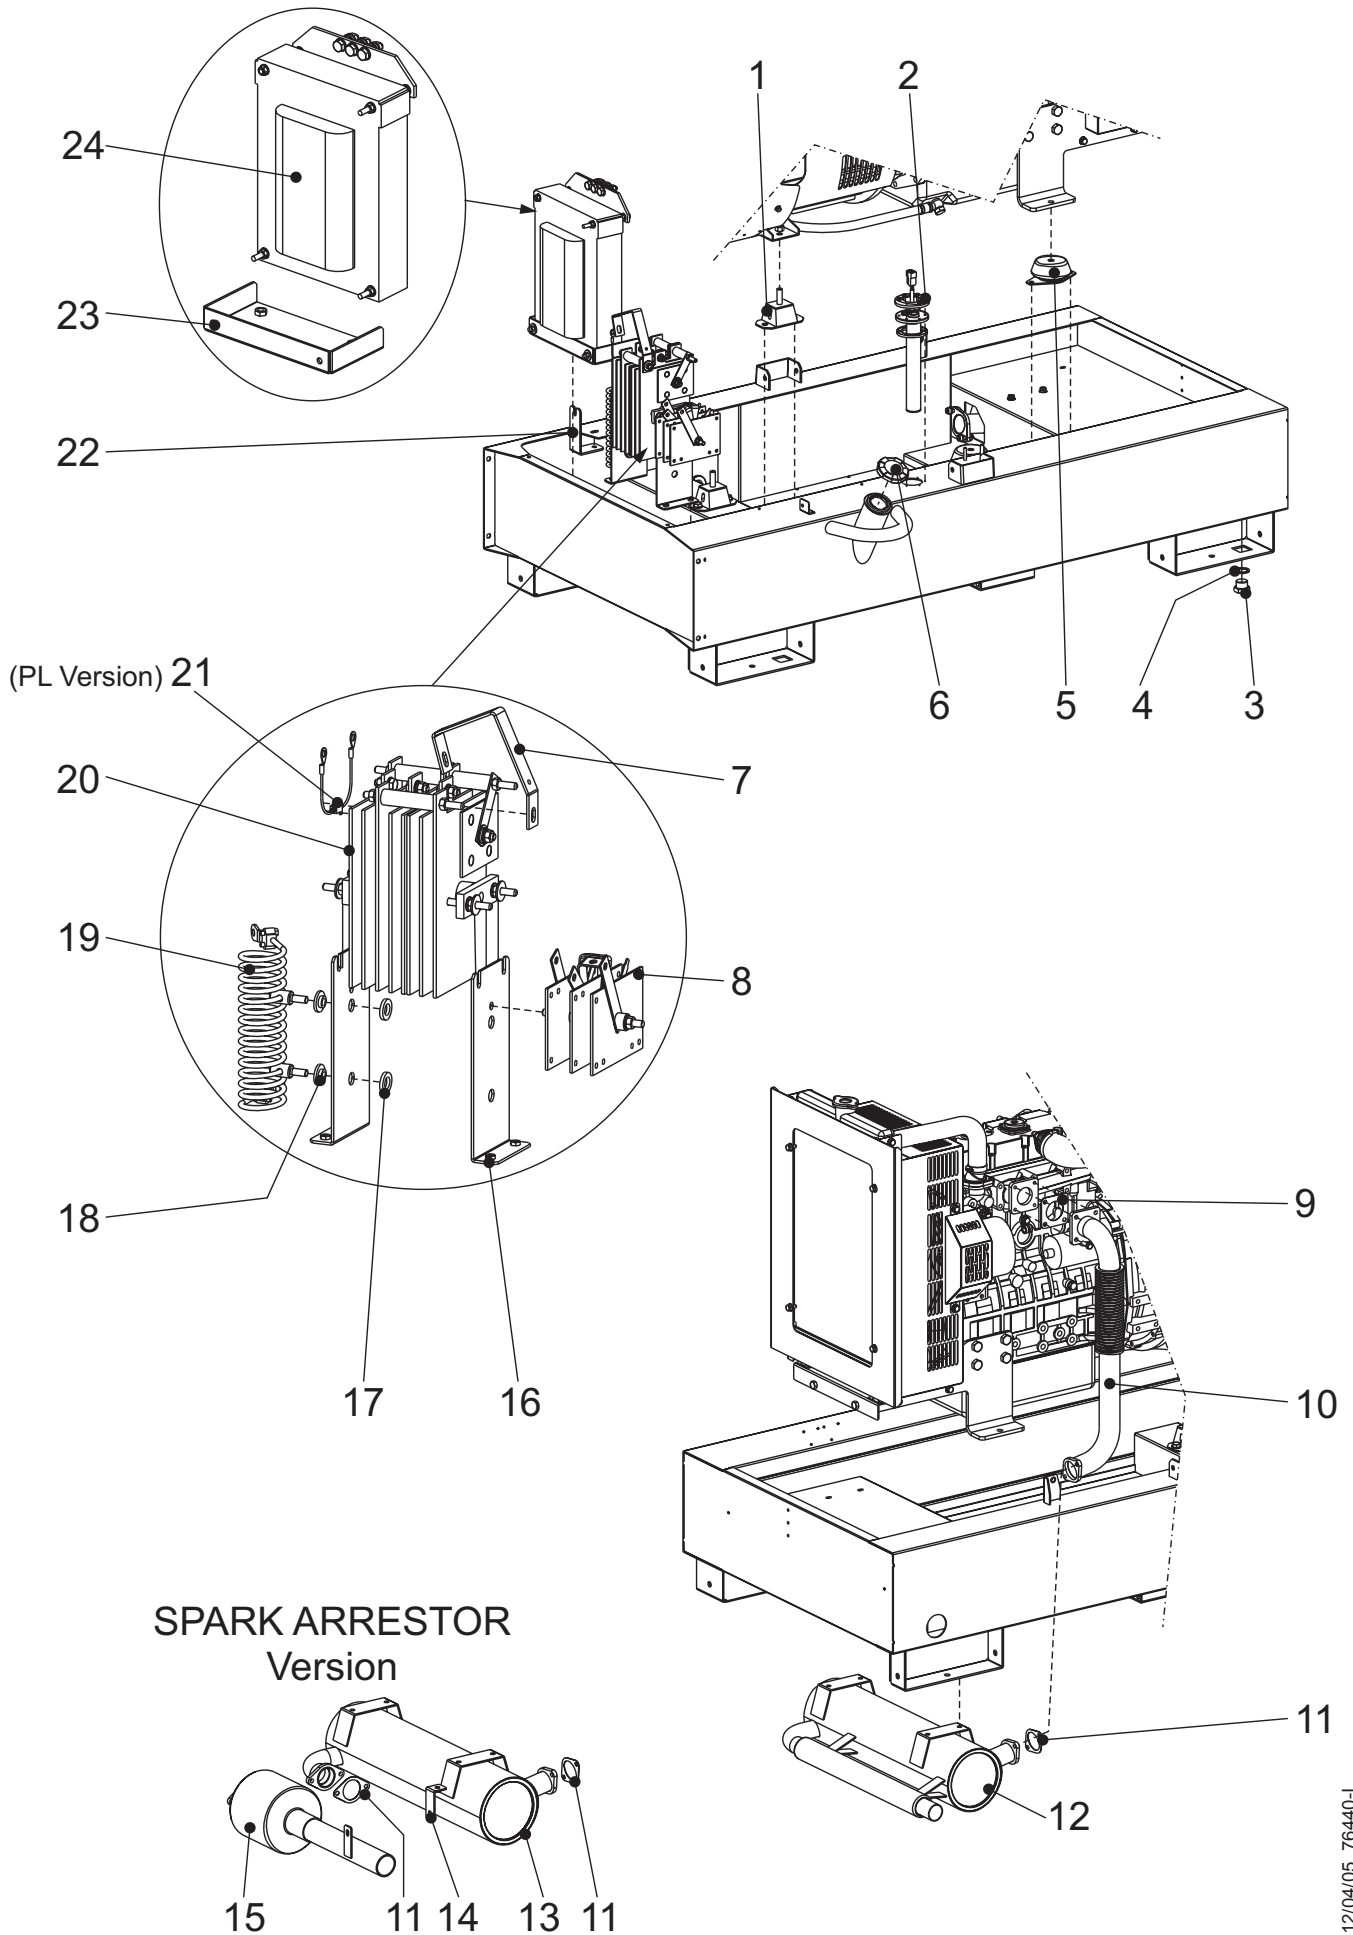


Pos.	Rev. Cod.	Descr.	Note
1	M105612070	ANTIVIBRANTE (40x50)	
2	M764409975	SENSORE LIVELLO CARBURANTE	
3	M308101262	TAPPO SCARICO SERBATOIO	
4	M308102023	GUARNIZIONE	
5	M317801035	ANTIVIBRANTE D.70x45 F-M12	
6	M342202026	TAPPO SERBATOIO	
7	M107509890	SHUNT DI MISURA	
8	M366105090	PONTE DI BASE	
9	M841562071	GUARN.SCARICO MOTORE 403C-15G	
10	M764402070	TUBO DI SCARICO	
11	M305232071	GUARNIZIONE PER FLANGIA	
12	M764402050	SILENZIATORE SCARICO	
13	M764412050	SIL. SCARICO PER PARASCINTILLE	(Spark arrestor version)
14	M764412093	SQUADRETTA BLOCC. TUBO SCARICO	(Spark arrestor version)
15	M764412078	RACCORDO TUBO SILENZ. SCARICO	(Spark arrestor version)
16	M366105091	STAFFA	
17	M309014013	DISTANZIALE	
18	M309015043	RONDELLA	
19	M766704010	RESISTORE DI POTENZA	
20	M317805100	PONTE DIODI	
21	M873769895	RESISTENZA CABLATA	(PL Version)
22	M366104118	SQUADRETTA FISSAGGIO REATTORE	
23	M366104110	STAFFA SUPPORTO REATTORE	
24	M364124100	REATTORE DI LIVELLO	

Pos.	Rev. Cod.	Descr.	Note
1	M105612070	VIBRATION-DAMPER (40x50)	
2	M764409975	FUEL LEVEL SENSOR	
3	M308101262	FUEL TANK CAP	
4	M308102023	GASKET	
5	M317801035	VIBRANTION DAMPER D.70x45 F-M12	
6	M342202026	CAP, FUEL TANK	
7	M107509890	SHUNT	
8	M366105090	BASE CURRENT BRIDGE	
9	M841562071	GASKET, ENGINE EXHAUST 403C-15G	
10	M764402070	EXHAUST TUBE	
11	M305232071	GASKET X FAN	
12	M764402050	EXHAUST MUFFLER	
13	M764412050	EXHAUST SILENCER FOR SPARK ARRESTOR	(Spark arrestor version)
14	M764412093	ARREST BRACKET, EXHAUST PIPE	(Spark arrestor version)
15	M764412078	CONNECTOR EXHAUST PIPE SILENCER	(Spark arrestor version)
16	M366105091	RECTIFIER ASSY BRACKET	
17	M309014013	SPACER	
18	M309015043	WASHER	
19	M766704010	POWER RESISTANCE	
20	M317805100	DIODE BRIDGE	
21	M873769895	WIRED RESISTOR	(PL Version)
22	M366104118	REACTANCE BRACKET	
23	M366104110	REACTANCE SUPPORT BRACKET	
24	M364124100	REACTANCE	

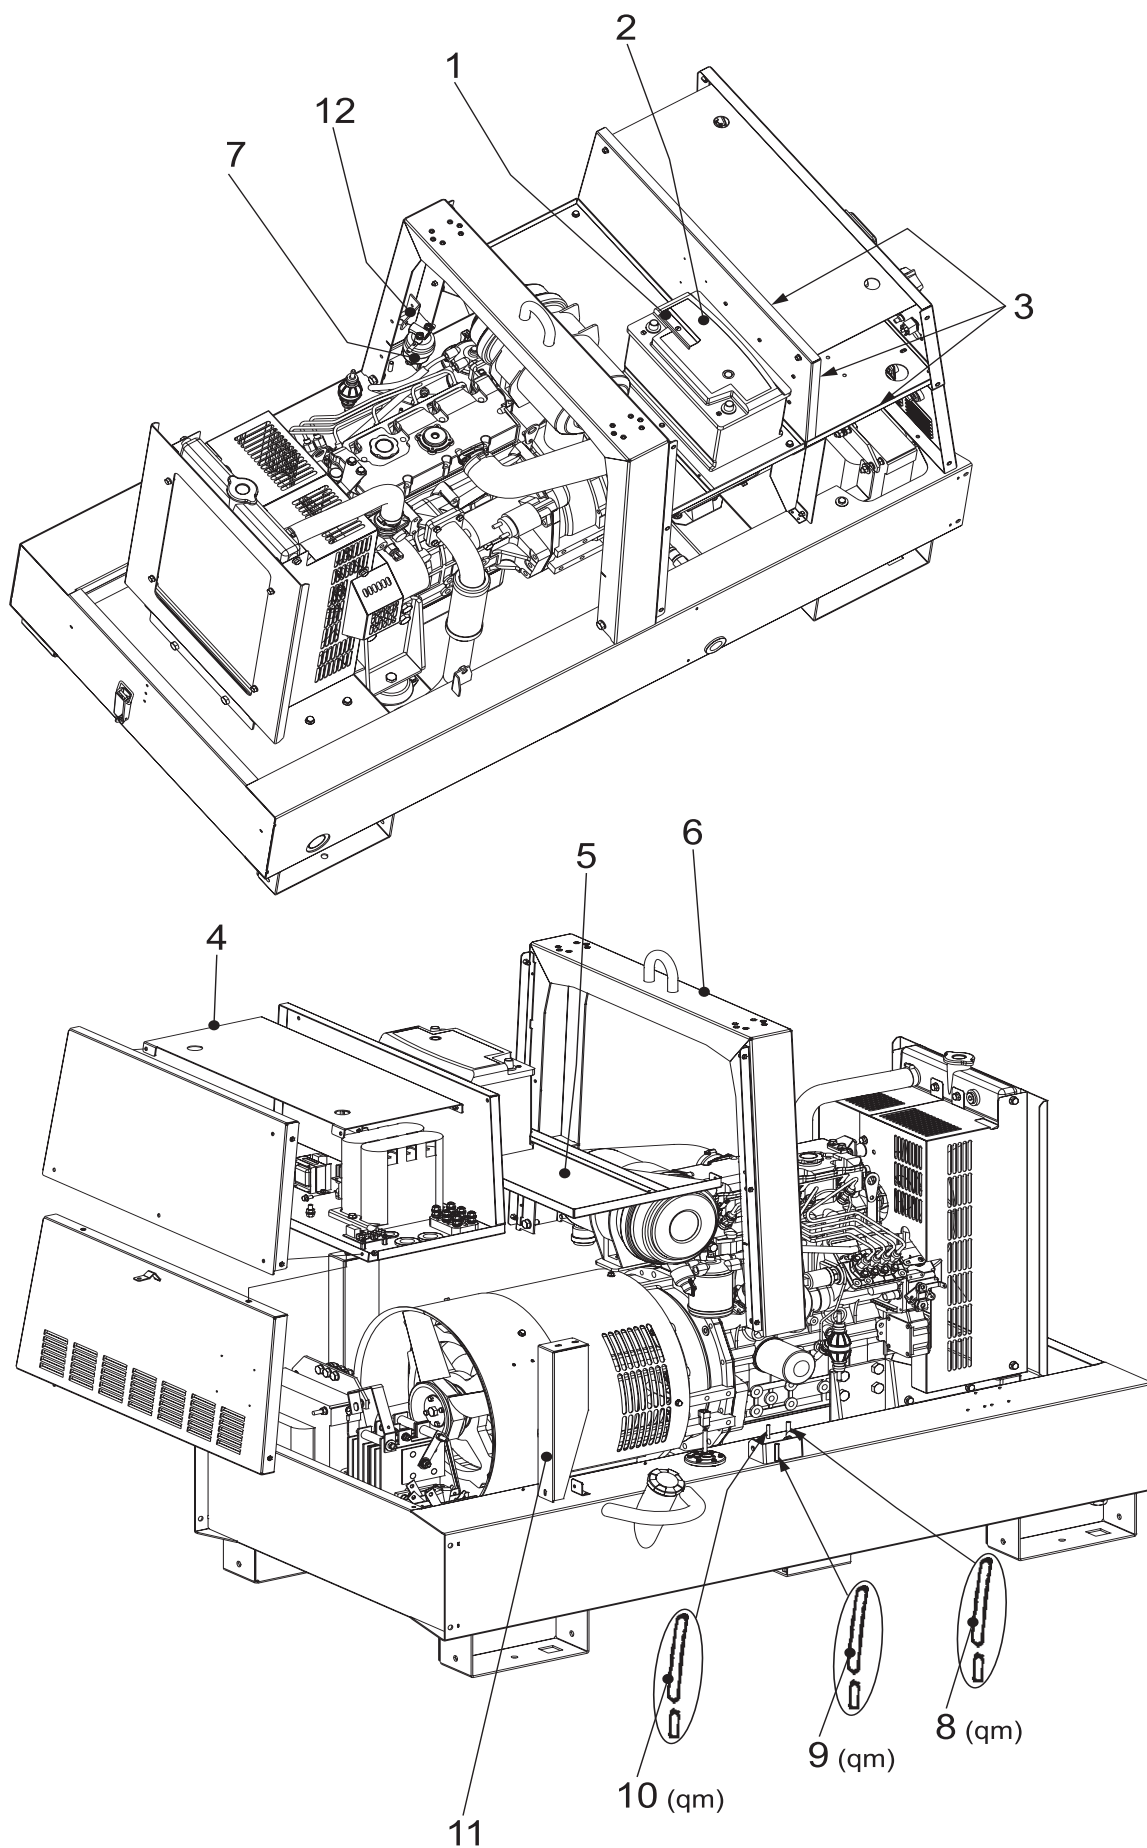


Pos.	Rev.	Cod.	Descr.	Note
1		M400409154	STAFFA FISSAGGIO BATTERIA	
2		M764409150	BATTERIA 12V 105Ah(SENZA MANU)	
3		M105112270	GUARNIZIONE (L=MT.1)	
4		M764407015	COPERCHIO SCATOLA ELETTRICA	
5		M764408290	PARATIA SUPERIORE ALTERNATORE	
6		M764401100	ROLL-BAR	
7		M256602228	FILTRO GASOLIO	Fino a REV.0-04/05 Del.21/09-03/03/09
7		M841562228	FILTRO SEPARATORE ACQUA	Da REV.1-09/10 Del.21/09-03/03/09
8		M308102207	TUBO GOMMA (L=MT.1)	qm
9		M107301890	TUBO SFIATO (L=MT.1)	qm
10		M307402208	TUBO GOMMA (L=MT.1)	qm
11		M764408239	TRAVERSINO SUPP. PARATIA ALT.	
12		M764402241	STAFFA SUPP. FILTRO CARBURANTE	Da REV.1-09/10 Del.21/09-03/03/09

Pos.	Rev.	Cod.	Descr.	Note
1		M400409154	BATTERY BRACKET	
2		M764409150	BATTERY 12V 105Ah (WITHOUT MAINENANCE)	
3		M105112270	STRIP, SEALING (L=MT.1)	
4		M764407015	ELECTRICAL BOX COVER	
5		M764408290	ALTERNATOR TOP BULKHEAD	
6		M764401100	ROLL-BAR	
7		M256602228	FUEL FILTER	Up to REV.0-04/05 Del.21/09-03/03/09
7		M841562228	FUEL PRE FILTER	From REV.1-09/10 Del.21/09-03/03/09
8		M308102207	PIPE	qm
9		M107301890	PIPE, BREATHER (L=MT.1)	qm
10		M307402208	PIPE	qm
11		M764408239	ALTERNATOR SUPPORT BRACKET BULKHEAD	
12		M764402241	SUPPORT FUEL FILTER	From REV.1-09/10 Del.21/09-03/03/09

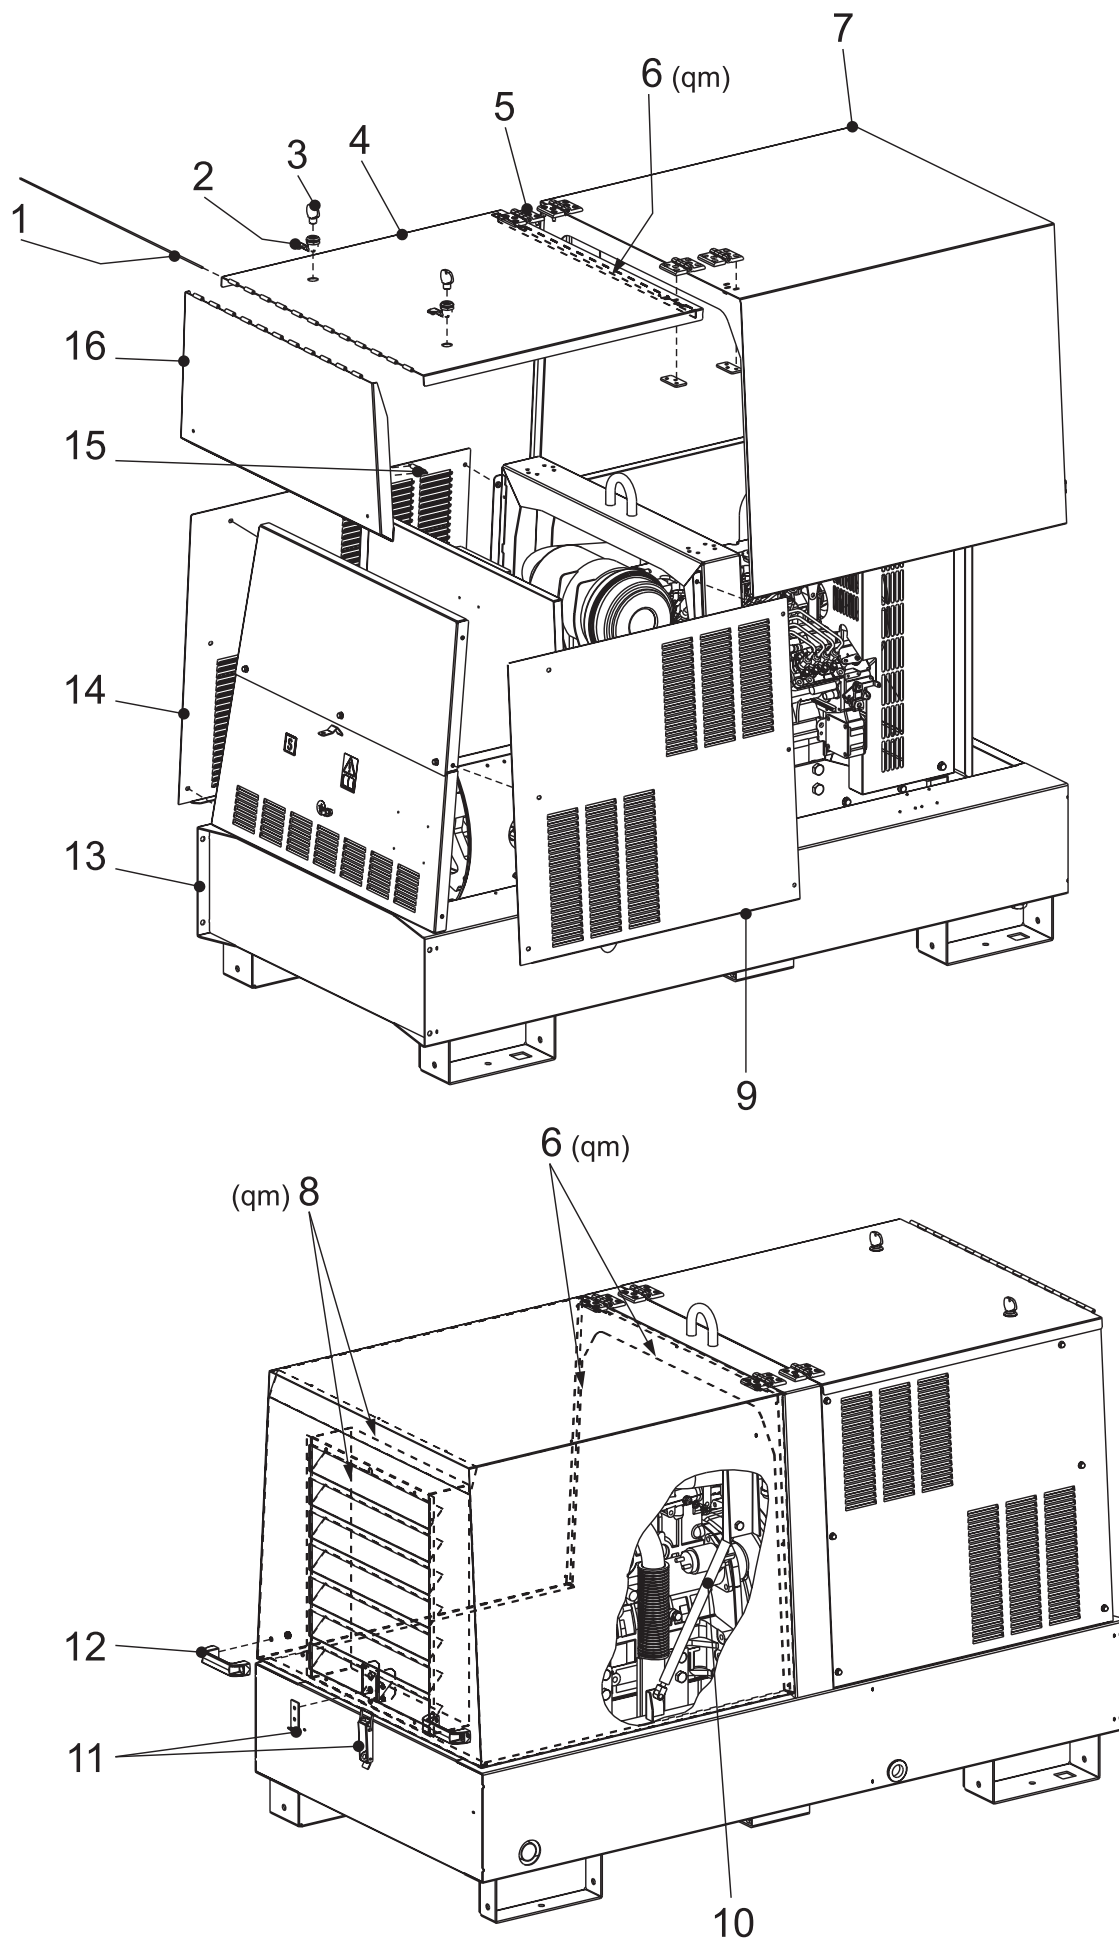


Pos.	Rev. Cod.	Descr.	Note
1	M343338270	PERNO PER CERNIERA	
2	M765008112	SERRATURA	
3	M765007057	CHIAVE PER SERRATURA	
4	M841508021	COPERCHIO CARENATURA ANTERIORE	
5	M744508140	CERNIERA PER FIANCATA	
6	M105112270	GUARNIZIONE (L=MT.1)	qm
7	M764408035	CARENATURA POSTERIORE	
8	M102302280	GUARNIZIONE (L=MT.1)	qm
9	M764408010	FIANCATA (dx) CARENATURA ANT.	
10	M305718115	PISTONE SOSTEGNO	
11	M107300180	CHIUSURA COMPL.A LEVA	
12	M343339601	MANIGLIA	
13	M764401050	BASAMENTO	
14	M764408015	FIANCATA (sx) CARENATURA ANT.	
15	M102042870	MOLLA	
16	M343338100	COPERCHIO FRONTALE	

Pos.	Rev. Cod.	Descr.	Note
1	M343338270	HINGE PIN	
2	M765008112	LATCH FOR ELECTRICAL BOX COVER	
3	M765007057	ELECTRIC BOX COVER KEY	
4	M841508021	FRONT HOUSING COVER	
5	M744508140	LATCH	
6	M105112270	STRIP, SEALING (L=MT.1)	qm
7	M764408035	COVER, REAR	
8	M102302280	GASKET (L=MT.1)	qm
9	M764408010	FRONT COVER (RIGHT) SIDE	
10	M305718115	SUPPORT, REAR COVER	
11	M107300180	LATCH	
12	M343339601	KNOB	
13	M764401050	BASE	
14	M764408015	FRONT COVER (LEFT) SIDE	
15	M102042870	SPRING	
16	M343338100	FRONT COVER	

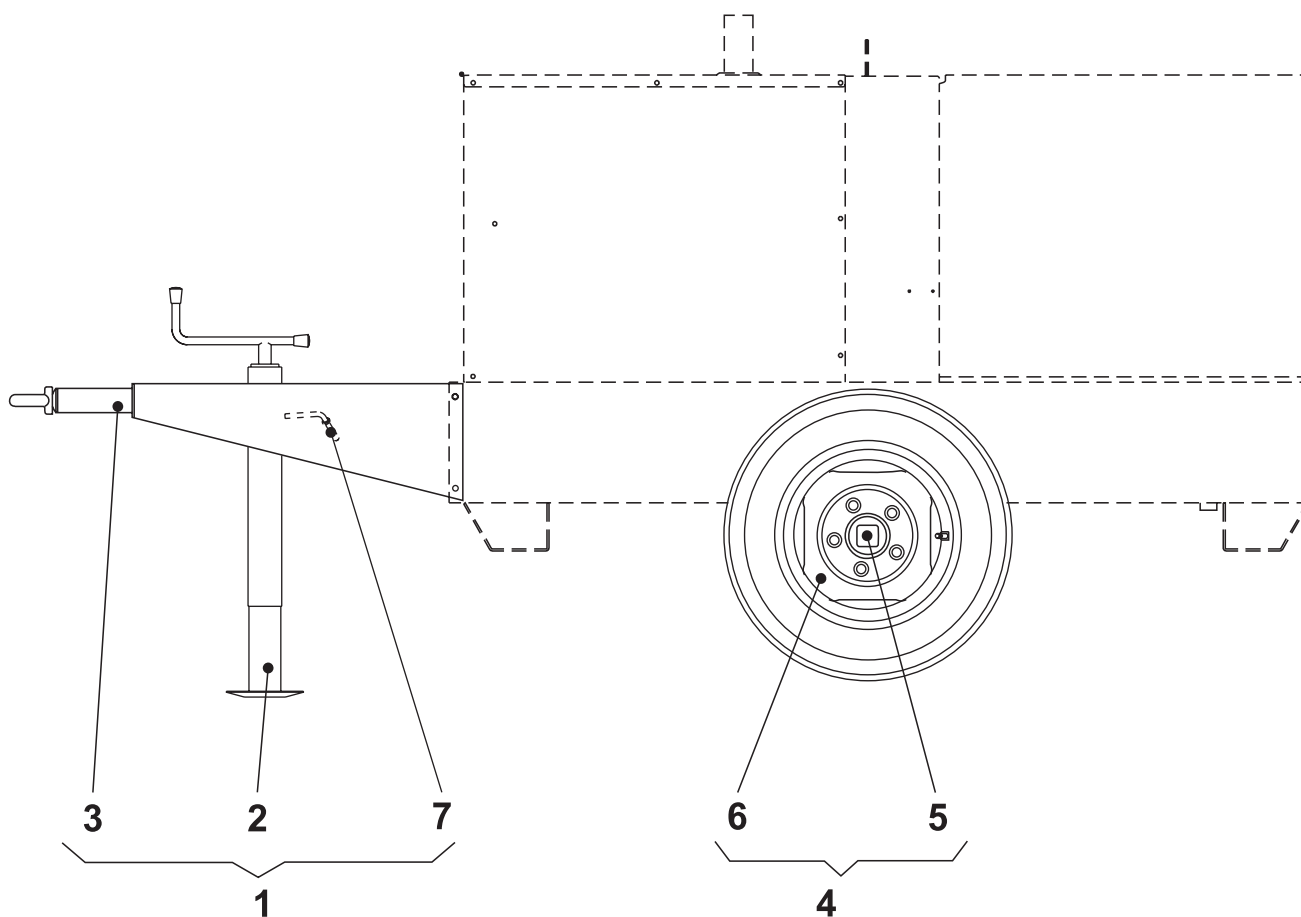

Pos.	Rev.	Cod.	Descr.	Descr.	Note
1		0000225100141	GR.TIMONE,PIEDE x TRAINO LENTO	KIT SITE TOW	Da/from REV.1-02/07 - Del.09 del.26/01/07
1	A	0000305200141	GR.TIMONE,PIEDE xTRAINO LENTO	KIT SITE TOW	Fino a/up to REV. 0-12/02 - Del.09 del.26/01/07
2		342231051	PIEDE DI STAZIONAMENTO	PARKING STAND	Da/from REV.1-02/07 - Del.09 del.26/01/07
2		102351750	PIEDE DI STAZIONAMENTO	PARKING STAND	Fino a/up to REV. 0-12/02 - Del.09 del.26/01/07
3		305751150	TIMONE	TOW BAR	Da/from REV.1-02/07 - Del.09 del.26/01/07
3		305201150	TIMONE	TOW BAR	Fino a/up to REV. 0-12/02 - Del.09 del.26/01/07
4	A	0000305600142	GR.ASSALE,RUOTE x TRAINO LENTO	KIT SITE TOW	era 305600142 10/12/02
5		305751160	ASSALE	AXLE	
6		105612030	RUOTA	WHEEL	
7		305751062	MANIGLIA BLOCC. PIEDE STAZION.	FIXING HANDLE PARKING STAND	Da/from REV.1-02/07 - Del.09 del.26/01/07

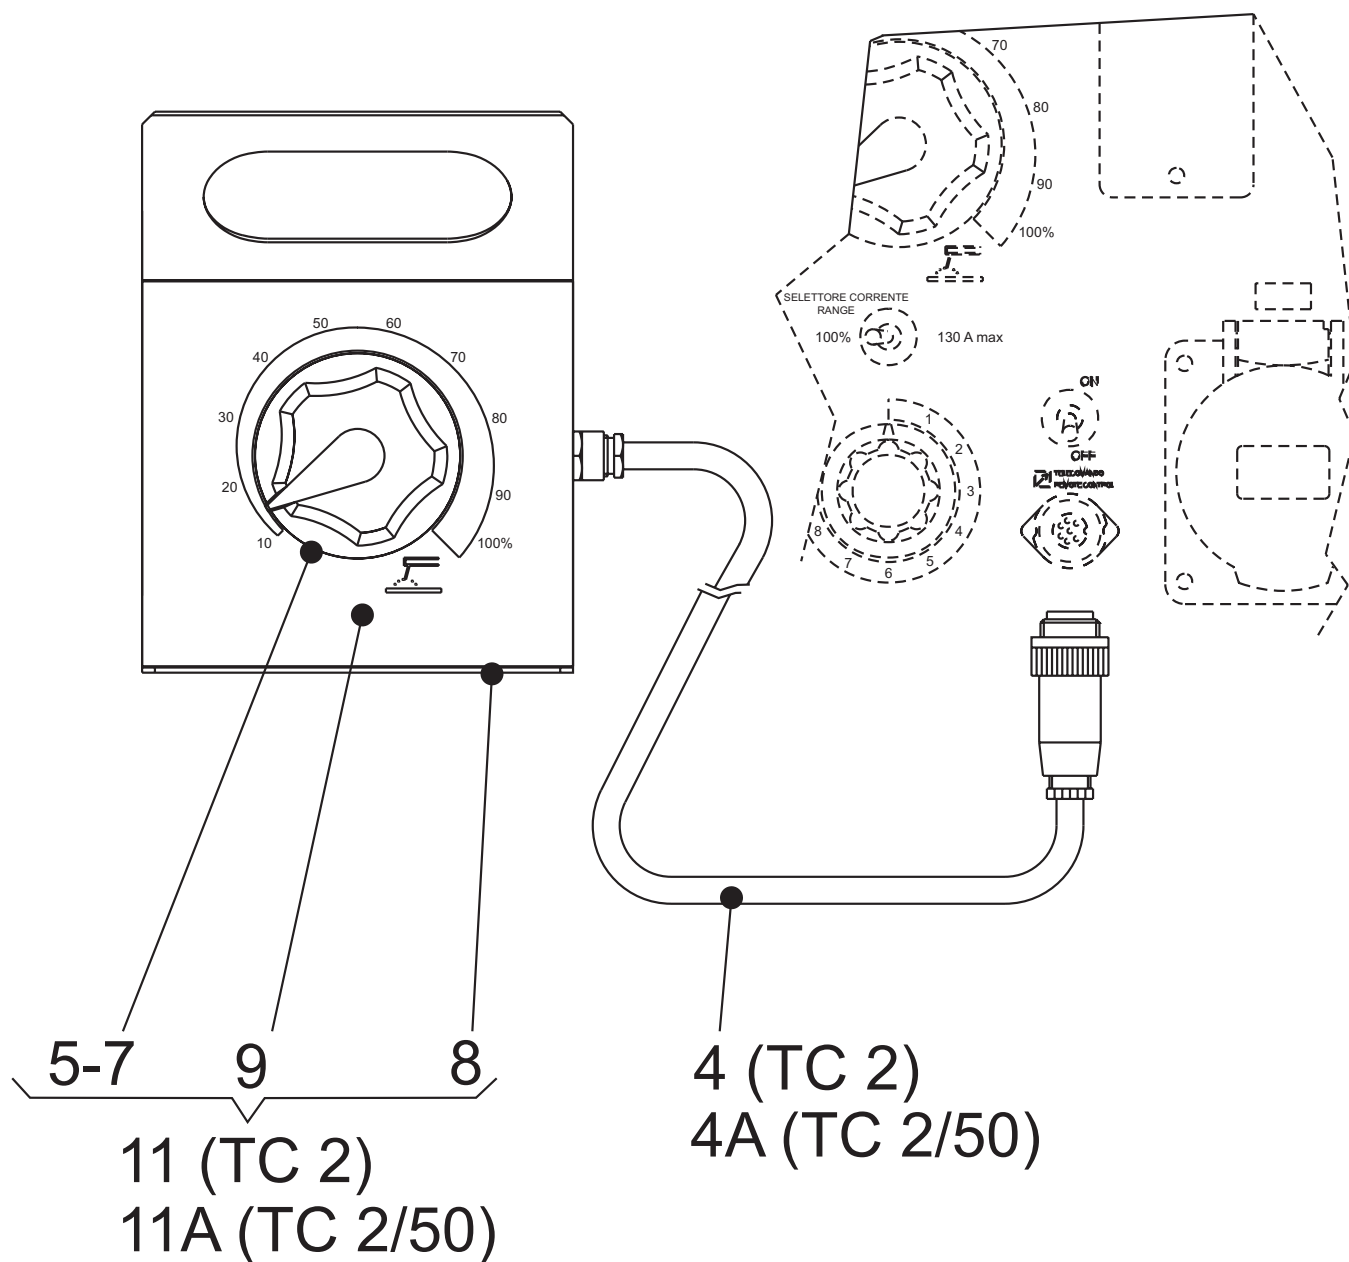

Pos.	Cod.	Descr.	Note
4	209519904	CONNETTORE COMPLETO DI CAVI / <i>CONNECTOR WITH CABLES</i>	TC2 vers.
4a	930609904	CONNETTORE CON CAVI / <i>CONNECTORS WITH CABLES</i>	TC2/50 vers.
5	107509702	MANOPOLA REG.CORRENTE SALDAT. / <i>KNOB,WELDING CURRENT REGULAT.</i>	
7	107509700	POTENZIOMETRO / <i>WELDING CURRENT REGULATOR</i>	Fino a/ <i>Up to</i> REV. 10/99 - Del. 129/06 - 04/09/07
7	836709715	POTENZIOMETRO / <i>WELDING CURRENT REGULATOR</i>	Da/From REV. 07/07- Del. 129/06 - 04/09/07
8	107509900	SCATOLA / <i>CASE, BOTTOM HALF</i>	
9	209519901	COPERCHIO (CD) / <i>COVER</i>	
11	209510018	TC2 COMANDO DISTANZA STD / <i>TC2 STD REMOTE CONTROL</i>	
11a	930600018	TC2/50 COMANDO DISTANZA STD / <i>TC2/50 STD REMOTE CONTROL</i>	

